

# **LinMot<sup>®</sup>**

## Documentation of *LinMot-Talk 6* Configuration Software



## **LinMot-Talk 6** User Manual

© 2015 NTI AG

This work is protected by copyright.

Under the copyright laws, this publication may not be reproduced or transmitted in any form, electronic or mechanical, including photocopying, recording, microfilm, storing in an information retrieval system, not even for didactically use, or translating, in whole or in part, without the prior written consent of NTI AG.

LinMot® is a registered trademark of NTI AG.

**Note**

The information in this documentation reflects the stage of development at the time of press and is therefore without obligation.

NTI AG reserves itself the right to make changes at any time and without notice to reflect further technical advance or product improvement.

Document version 6.6 / July 2016

## Table of Content

1	Introduction .....	4
1.1	System Generation (SG) .....	4
1.2	UPID (Unique Parameter ID) .....	4
1.3	PnP (Plug and Play) .....	5
2	Overview .....	6
2.1	Tool button bar .....	7
2.2	Control Panel .....	8
2.3	Messages .....	9
2.4	Errors .....	10
2.5	Oscilloscope .....	10
2.6	Curves .....	11
2.7	Parameters .....	13
2.8	Variables .....	14
2.9	Command Table .....	15
2.10	Access Codes .....	16
3	Quick Start Guide .....	18
3.1	Cabling E1100 .....	18
3.2	Cabling E1200 .....	19
3.3	Cabling E1400 .....	20
3.4	Cabling B1100 .....	21
3.5	Cabling B8050-ML .....	22
3.6	Cabling A1100 .....	23
3.7	Cabling C1100 .....	24
3.8	Cabling C1200 .....	25
3.9	Cabling M8000 .....	26
3.10	Firmware Download .....	27
3.11	Login .....	29
3.12	Scanning CAN Bus .....	29
3.13	Scanning Ethernet .....	30
3.14	Motor Wizard .....	31
3.15	Continuous Curve Mode .....	37
3.16	Defining Curves .....	38
3.17	Control Status .....	43
3.18	Oscilloscope .....	44
3.19	Continuous Two Point Mode .....	45
3.20	Export Configuration .....	46
3.21	Import Configuration .....	46
3.22	Open Offline Configuration .....	47
3.23	Create Offline Configuration .....	48
3.24	Compare Parameters .....	49
4	Trouble shooting .....	50
4.1	Setting all Parameters to Default Values .....	50
4.2	Interface does not run .....	51
4.3	Stopping Firmware .....	51
5	Contact Addresses .....	52

## 1 Introduction

The LinMot-Talk 6 software is a PC based tool, which helps the user in a comfortable way installing firmware on the drive, setting up the drive's configuration, defining and programming motion profiles, emulating the PLC, watching variables and reading messages and errors. The LinMot-Talk 6 works with the drive series A1100, B1100, C1100, E1100, C1200, E1200, E1400 and B8050. It replaces the LinMot-Talk1100 software. For the rest of this document and all other documents, the more general term "LinMot-Talk" will be used for the Linmot- PC configuration software.

### 1.1 System Generation (SG)

The LinMot drive families are based on different hardware platforms, which are called system generations. The abbreviation is "SG". Whereas differences of hardware of software functionality exist between the system generations, the documentation is marked with the "SG" term. The following table gives an overview of which drive family belongs to which SG:

SG	Drives
SG1	Families E400, E4000 V1 (not supported by LinMot-Talk 6)
SG2	Families E400, E4000 V2 (not supported by LinMot-Talk 6)
SG3	Family E1100 (GP, CO, DN, DP) (LC/HC/XC)
SG4	Family B1100 (VF, PP, GP, ML) (LC/HC/XC)
SG5	Family E1200 (GP, DP, DS, EC, IP, PD, PL, PN, SC, SE) Family E1400 (GP, DP, DS, EC, IP, PD, PL, PN, SC, SE) (0S/1S) Family B8000-ML (GP, EC, IP, PL, PN, SC)
SG6	Family C1250 (DS, EC, IP, PD, PL, PN, SC, SE) (0S/1S) Family E1400V2 (GP, DP, DS, EC, IP, PD, PL, PN, SC, SE) (0S/1S)
SG7	Family A1100 Family C1100 (GP, DS, EC, PD, PN, SE) (0S/1S)

### 1.2 UPID (Unique Parameter ID)


All parameters have an assigned identification number, which is called a UPID (Unique Parameter ID). All parameters are accessed on the drive over this identification.

### 1.3 PnP (Plug and Play)

The drive families A1100, C1100, C1200, E1200 and E1400 support the so called „Plug and Play“ functionality. When a motor is connected to the drive, the motor will be automatically detected and the parameters will be set accordingly. The drive then can control the motor without any further configuration procedure. When starting the motor wizard, the connected motor is already selected and all the further configuration, such as exact slider, moving mass, friction etc can be set up.

All components (drives and motors) which support the plug and play functionality are marked on the type label with “PnP”.

The drive startup sequence is the following:

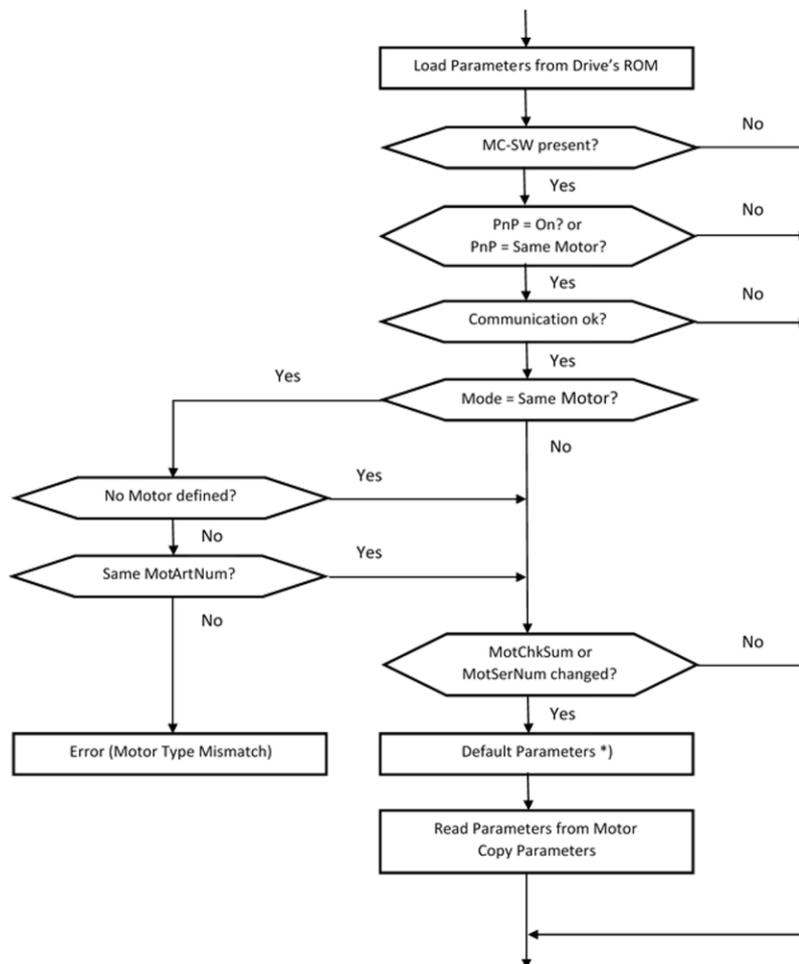

\*) All parameters, which are set by the previous PnP motor and do not exist in the new motor will be set to default values prior to load the new parameters.

## 2 Overview

The following screenshot gives an overview of the different functions integrated in the LinMot-Talk software.

The screenshot displays the LinMot-Talk 6.5 software interface, which is divided into several functional areas:

- Configuration and Setup Tools:** Located in the top-left, this area includes a project tree on the far left and a central 'Control' panel with a list of parameters (e.g., Switch On, STO, Quick Stop) and their current states.
- Drive Selection:** A central area for selecting and configuring the drive, showing parameters like 'Control Word' (003Fh) and 'Override Value'.
- Shortcuts to Tools:** A set of icons and buttons located below the drive selection area, used for quick access to various functions.
- Control/Status Window:** A large central window displaying the 'Status' of the system, including operational flags (e.g., Operation Enabled, Motion Active) and error/warning messages.
- Project tree Window:** A vertical pane on the left side showing the hierarchical structure of the project files.
- IO Panel:** A section below the drive selection area showing digital input and output channels (e.g., X4.5 - Input, X4.3 - Output) with their current states.
- Motion Command Window:** A section on the right side for sending motion commands, featuring a 'Command Type' dropdown, a 'Count Nibble' field, and a table for defining command parameters.
- Monitoring Window:** A section on the far right providing real-time monitoring data, such as 'Actual Position', 'Demand Position', 'Motor Current', and 'Motor Supply Volt'.

## 2.1 Tool button bar




The tool button bar is always present and consists of the following buttons (from left):

-  **Show/Hide Tree** shows or hides the project tree window.
-  **Up** sets the focus in the project tree to the parent of the selection.
-  **Toggle** toggles between the last two displayed tree branches.
-  **Import Configuration** imports configurations to the drives.
-  **Export Configuration** exports configurations. Different drives and parts, such as parameters, variables, oscilloscope or curves, can be selected to be exported.
-  **Save All** exports all configurations from the drives.
-  **Print** prints items like curves, parameter configurations etc.
-  **Install Firmware** Start the drive's firmware installation.
-  **Open Login**, login to all drives in the selected workspace.
-  **Save Login**, save the actual workspace
-  **Reboot** restarts the firmware on the drive.
-  **Stop** stops the firmware on the drive, used for downloading and software configuration.
-  **Blink** sends a blink LED command to the drive, which is selected.
-  **Default:** Parameters can be defaulted by instances. With this button, the default parameter procedure is started. A window will be shown where the instances (OS, MC, INTF and APPL software) can be selected. All parameters of the selected instances will be set to their default value.
-  **Go Offline** logs out from actual drive.
-  **Start Motor Wizard** starts the motor configuration setup wizard.
-  **Show Control Panel** switches to the control panel.
-  **Show Parameters** switches to the variables.
-  **Show Variables** switches to the variables.
-  **Show Oscilloscope** switches to the oscilloscope.
-  **Show Messages** switch to the message viewer.
-  **Show Errors** switches to error viewer.

-  **Show Curves** switches to the curve tool.
-  **Show Command Table** switches to the command table editor.
-  **Show Object Inspector** displays a window in which shows help information to each selected object.

## 2.2 Control Panel

The Control Panel helps the user to access directly to the control and status word of the MC Software. The drive can be commanded from the PC, thus no PLC is necessary to be used for the first commissioning.

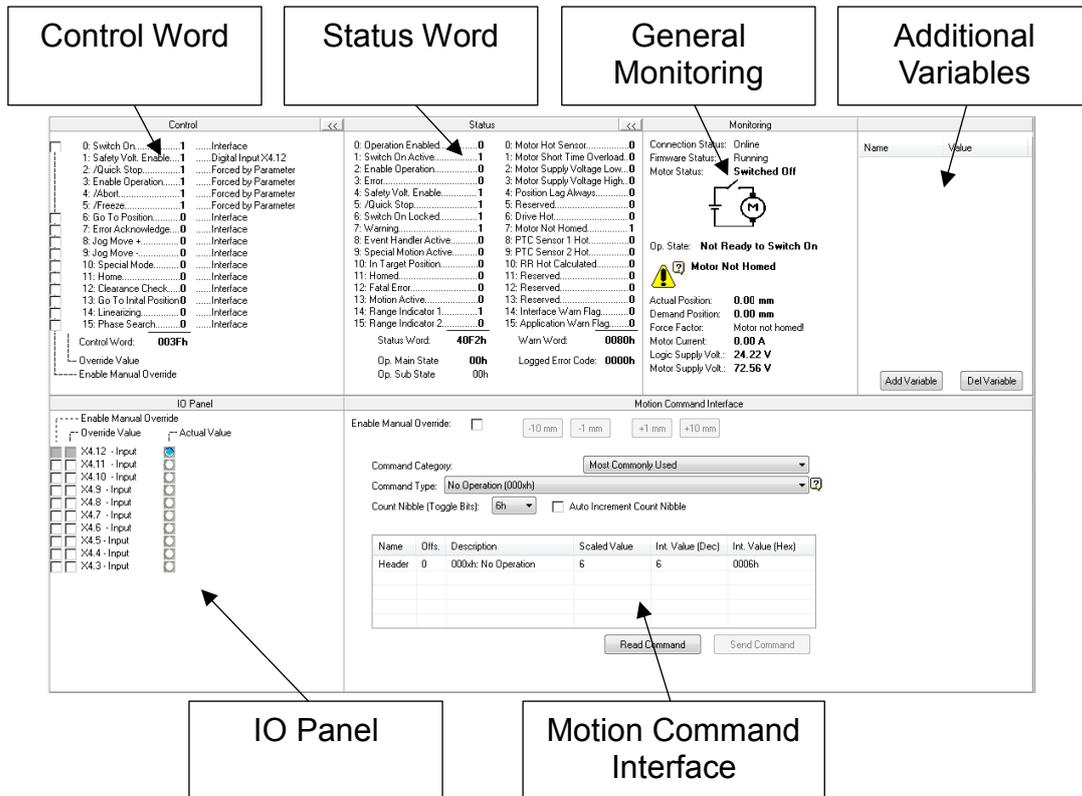

The screenshot shows the LinMot Control Panel software interface. It is divided into several sections:

- Control Word:** A list of 15 control words (e.g., Switch On, Safety Volt. Enable, Jog Move) with their current values and interface types. The Control Word is set to 003Fh.
- Status Word:** A list of 15 status words (e.g., Operation Enabled, Switch On Active, Error) with their current values. The Status Word is 40F2h.
- General Monitoring:** Displays connection status (Online), firmware status (Running), and motor status (Switched Off). It also shows a warning for 'Motor Not Homed' and various motor parameters like Actual Position (0.00 mm), Demand Position (0.00 mm), Force Factor, Motor Current (0.00 A), Logic Supply Volt. (24.22 V), and Motor Supply Volt. (72.56 V).
- Additional Variables:** A table with columns for Name and Value, currently empty.
- IO Panel:** A list of digital inputs (X4.12 to X4.3) with checkboxes for 'Enable Manual Override' and 'Override Value'.
- Motion Command Interface:** A section for sending commands, including a dropdown for 'Command Category' (Most Commonly Used), 'Command Type' (No Operation (0000h)), and 'Count Nibble' (6h). It includes a table for command details and 'Read Command' and 'Send Command' buttons.

- **Control Word** The MC software's control word can be directly written from the PC. For taking over the PC control the left check box (Enable Manual Override) must be selected. The state of each flag can be set with the right check box (Override Value). If other flags have to be altered, the override mask must be configured in the parameter tree under \Parameters\Motion Control SW\State Machine Setup\Control Word\Ctrl, Word Parameter Force Mask.
- **Status Word** The status word shows the actual state of the drive's MC software status word. It is updated automatically.
- **General Monitoring** This window displays actual motor and drive information
- **Additional Variables** In this window variables could be chosen, then they are shown in the list and would updated automatically.

- **IO Panel** For commissioning. The user can take control of the X4 IOs on E1100 or X14 IOs on B1100 drives.
- **Motion Command Interface** The MC software's motion command Interface can be directly accessed over this window. When enabled (Enable Manual Override switch must be set), MC commands can be selected, parametrized and sent to the drive. Because the motion command interface is, independent of the interface running on the drive, the same, the commands can be exactly tested before programming them in the PLC.

## 2.3 Messages


This panel reads out and shows all messages, which are logged on the drive, and displays them in chronological order. If logged in a B1100 series drive, this window does not appear, because those drives do not support message logging.

Event Time	Message	Source
001604:11:32.773	MC SW Started	MC SW State Machine
001604:11:30.710	Software Reset	OS
001604:11:23.897	MC SW Stopped	MC SW State Machine
001584:39:45.813	Trn To Error State	MC SW State Machine
001584:39:44.008	MC SW Started	MC SW State Machine
001584:39:41.945	Software Reset	OS
001582:00:44.953	MC SW Stopped	MC SW State Machine
001581:40:15.176	Trn To Ready To Switch On State	MC SW State Machine
001581:10:53.469	Trn To Operation Enabled State	MC SW State Machine
001581:10:50.487	Trn To Ready To Switch On State	MC SW State Machine
001581:10:26.394	Trn To Error State	MC SW State Machine
001581:10:01.482	Trn To Ready To Switch On State	MC SW State Machine
001581:09:53.817	MC SW Started	MC SW State Machine
001581:09:51.754	Software Reset	OS
001581:09:51.603	MC SW Stopped	MC SW State Machine
001581:04:01.988	Trn To Error State	MC SW State Machine
001581:04:00.183	MC SW Started	MC SW State Machine
001581:03:58.120	Software Reset	OS
001581:03:57.969	MC SW Stopped	MC SW State Machine
001581:03:41.101	Trn To Error State	MC SW State Machine
001581:03:39.296	MC SW Started	MC SW State Machine
001581:03:37.233	Software Reset	OS
001581:03:37.082	MC SW Stopped	MC SW State Machine
001581:03:28.981	Trn To Error State	MC SW State Machine
001581:03:27.176	MC SW Started	MC SW State Machine
001581:03:25.113	Software Reset	OS

Messages Actual drive Time : 001604:23:08

## 2.4 Errors


This panel reads out and shows all errors, which are logged on the drive and displays them in chronological order.

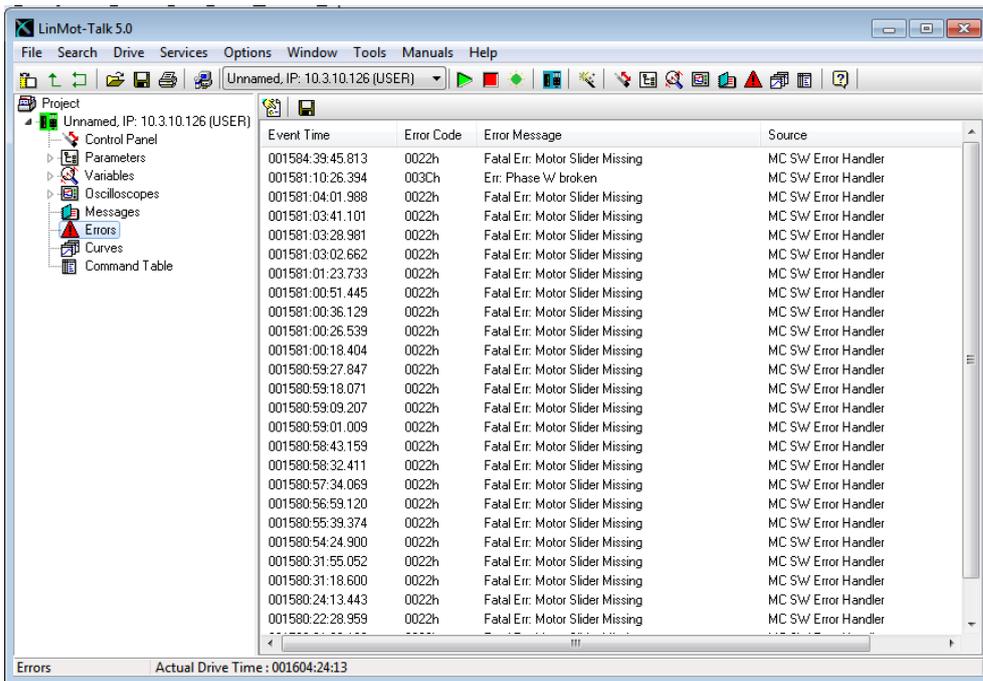

## 2.5 Oscilloscope

The drive's built in oscilloscope, which can record up to eight channels in real time, is controlled with the oscilloscope tool.

During login the oscilloscope reads out the settings and data from the drive. If an oscilloscope shot is running or ready to read out data, an item called "Read out" will be displayed. Otherwise a default item will be generated.

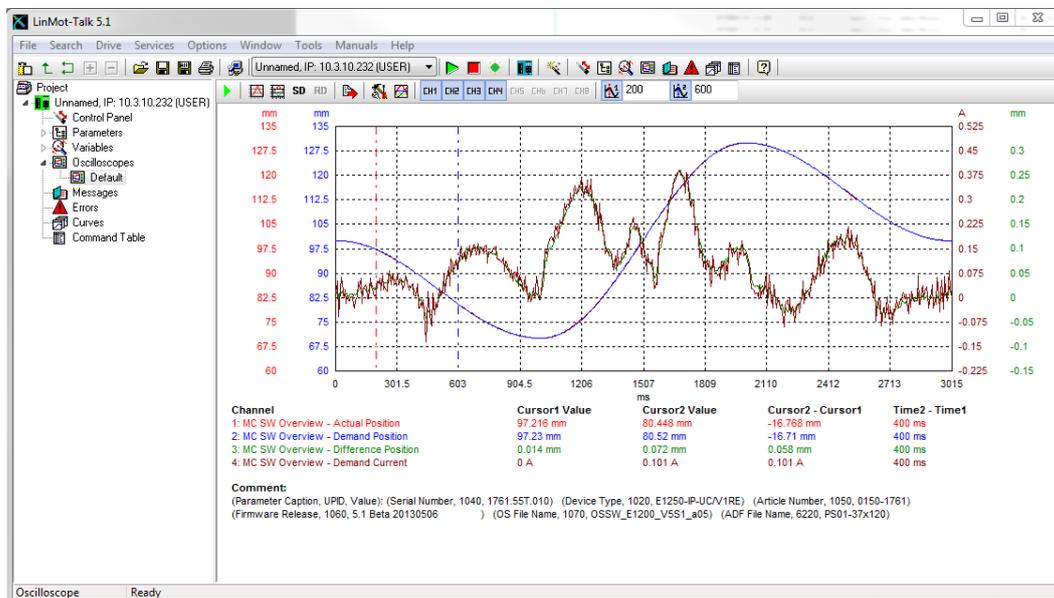

The oscilloscope is controlled with the buttons




The functions are (from left):

- **Start/Abort** Start or abort an oscilloscope shot.
- **Fit View** Displays the recorded channels such as they fit best in the scope window.
- **Fit View (same unit same fit)** Displays the recorded channels such as the channels with the same unit have the same scaling and offset.
- **Save Display** stores the settings for zoom, scaling and offset.
- **Recall Display** restores the settings for zoom, scaling and offset, which are previously stored with Save Display.
- **Export Data:** Export data and setups of the last recorded oscilloscope shot in a csv file.
- **Oscilloscope Settings** Switch to setup mask for channels, triggers, times and modes.
- **Display Settings** is used to set scale, offset and color for the oscilloscope channels.
- **Show/Hide:** Show and hide the oscilloscope channels.
- **Show/Hide Cursor:** Two time cursors can be displayed for measuring the signals.

## 2.6 Curves

With the curve tool, motor motion profiles can be easily created, joined, uploaded, downloaded and saved. NOTE: On B1100 the curve feature must be enabled with an access key.

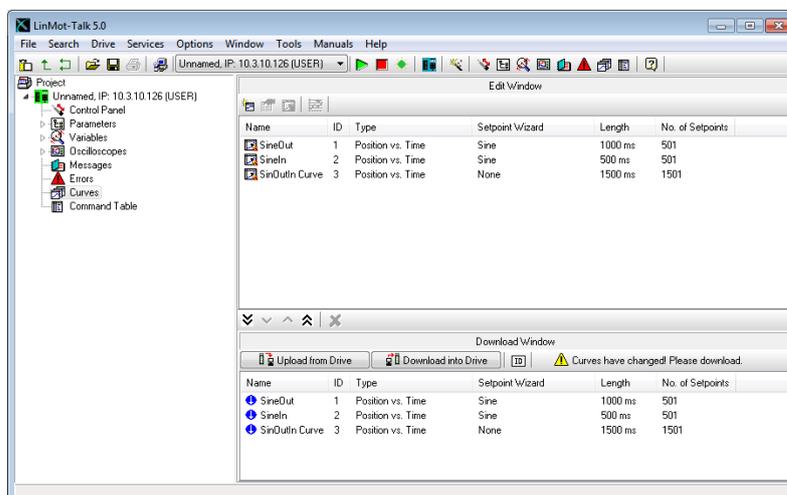

The curve tool is divided into the edit and the download window.

The edit window is used to generate, merge and modify curves with the following buttons:



-  **New Curve** Starts the curve wizard, which guides through the curve generation.
-  **Edit Properties** The properties of a selected curve, like name, time or stroke, can be modified.
-  **Edit Curve Values** The curve points can be manually edited.
-  **Join Curves** All selected curves are joined. A wizard will be started for defining the curve properties of the joined curve.

The download window is used to manage the curves, which are stored on the drive or have to be downloaded. Modifications in this window will show up the message “Curves have changed! Please download.” After pressing the download into Drive button the window and the drive will be synchronized.



- **Upload Curves from Drive** All curves stored on the drive will be uploaded and displayed.
- **Download Curves to Drive** The drive's curve sector will be synchronized with the download window.
-  **Auto Numerate Curves** The curve ID, which must be unique, will be set automatically.

The maximum number of curves and number of sample points is defined as follows:

Series B1100:

Max. 16 Curves

$$\#Curves * 70Bytes + \#SamplePoints^1 * 4Bytes \leq 2016Bytes$$

Series A1100/C1100

Max. 50 Curves

$$\#Curves * 70Bytes + \#SamplePoints * 4Bytes \leq 32512Bytes$$

All other Series:

Max. 100 Curves

$$\#Curves * 70Bytes + \#SamplePoints * 4Bytes \leq 65280Bytes$$


<sup>1</sup> #SamplePoint: total of sample points in all curves

<sup>1</sup> #SamplePoints: total of sample points in all curves.

## 2.7 Parameters

The drive's parameters are displayed in a tree view.

Parameters, which are marked as live () can be altered while the drive's firmware is running; other parameters can only be changed when the software is stopped.

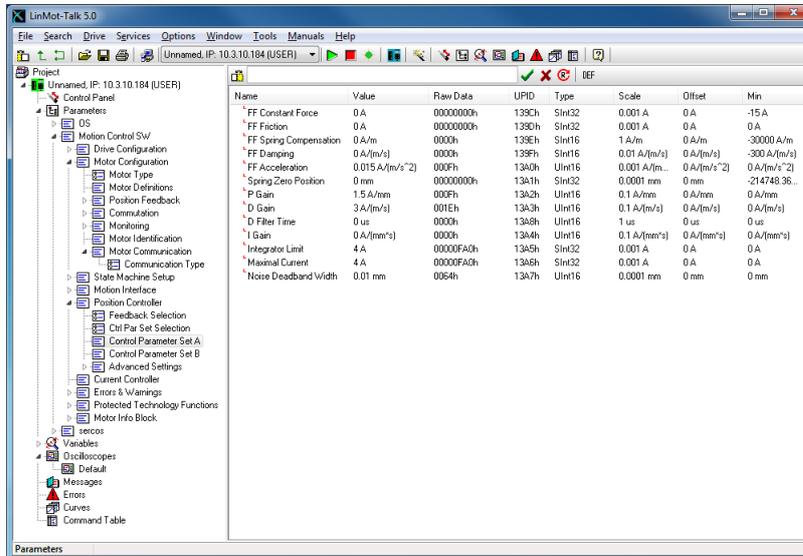


The parameter service is controlled with the following buttons:



-  **Show/Hide Details:** Additional information for each parameter, such as unique parameter ID (UPID), scaling, min/max value, can be displayed on demand.
-  **Show UPID Browser:** When parameters are edited, which represent a UPID, this button will be visible. With this button, the UPID browser will be opened for an easy selection of a parameter.
-  **OK:** The input value is confirmed with this button. Pressing the enter key has the same effect.
-  **Cancel:** This button cancels the value typed in.
-  **Read:** All parameters will be read and refreshed from the drive.

## 2.8 Variables

The drive's variables, which can be watched, are arranged in different functional groups. The MC SW overview group contains the most used variables.

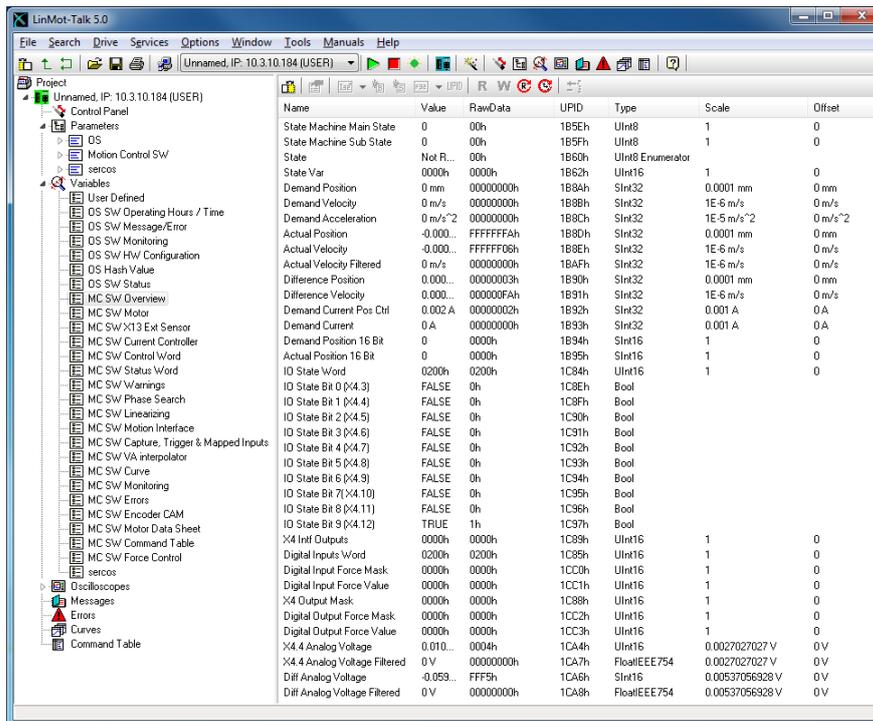

Name	Value	RawData	UPID	Type	Scale	Offset
State Machine Main State	0	00h	1B5Eh	UInt8	1	0
State Machine Sub State	0	00h	1B5Fh	UInt8	1	0
State	Not R...	00h	1B60h	UInt8 Enumerator		
State Var	0000h	0000h	1B62h	UInt16	1	0
Demand Position	0 mm	00000000h	1B84h	SInt32	0.0001 mm	0 mm
Demand Velocity	0 m/s	00000000h	1B86h	SInt32	1E-6 m/s	0 m/s
Demand Acceleration	0 m/s <sup>2</sup>	00000000h	1B88h	SInt32	1E-5 m/s <sup>2</sup>	0 m/s <sup>2</sup>
Actual Position	-0.000...	FFFFFFFFh	1B8Dh	SInt32	0.0001 mm	0 mm
Actual Velocity	-0.000...	FFFFFFFFh	1B8Eh	SInt32	1E-6 m/s	0 m/s
Actual Velocity Filtered	0 m/s	00000000h	1B8Fh	SInt32	1E-6 m/s	0 m/s
Difference Position	0.000...	00000003h	1B90h	SInt32	0.0001 mm	0 mm
Difference Velocity	0.000...	000000FAh	1B91h	SInt32	1E-6 m/s	0 m/s
Demand Current Pos Ctrl	0.002 A	00000020h	1B92h	SInt32	0.001 A	0 A
Demand Current	0 A	00000000h	1B93h	SInt32	0.001 A	0 A
Demand Position 16 Bit	0	0000h	1B94h	SInt16	1	0
Actual Position 16 Bit	0	0000h	1B95h	SInt16	1	0
ID State Word	0200h	0200h	1C84h	UInt16	1	0
ID State Bit 0 (x4.3)	FALSE	0h	1C8Eh	Bool		
ID State Bit 1 (x4.4)	FALSE	0h	1C8Fh	Bool		
ID State Bit 2 (x4.5)	FALSE	0h	1C90h	Bool		
ID State Bit 3 (x4.6)	FALSE	0h	1C91h	Bool		
ID State Bit 4 (x4.7)	FALSE	0h	1C92h	Bool		
ID State Bit 5 (x4.8)	FALSE	0h	1C93h	Bool		
ID State Bit 6 (x4.9)	FALSE	0h	1C94h	Bool		
ID State Bit 7 (x4.10)	FALSE	0h	1C95h	Bool		
ID State Bit 8 (x4.11)	FALSE	0h	1C96h	Bool		
ID State Bit 9 (x4.12)	TRUE	1h	1C97h	Bool		
x4 Infr Outputs	0000h	0000h	1C98h	UInt16	1	0
Digital Inputs Word	0200h	0200h	1C98h	UInt16	1	0
Digital Input Force Mask	0000h	0000h	1CC0h	UInt16	1	0
Digital Input Force Value	0000h	0000h	1CC1h	UInt16	1	0
x4 Output Mask	0000h	0000h	1C98h	UInt16	1	0
Digital Output Force Mask	0000h	0000h	1CC2h	UInt16	1	0
Digital Output Force Value	0000h	0000h	1CC3h	UInt16	1	0
x4.4 Analog Voltage	0.010...	0004h	1CA4h	UInt16	0.0027027027 V	0 V
x4.4 Analog Voltage Filtered	0 V	00000000h	1CA7h	FloatIEEE754	0.0027027027 V	0 V
Dif Analog Voltage	-0.059...	FFFFh	1CA6h	SInt16	0.00537056928 V	0 V
Dif Analog Voltage Filtered	0 V	00000000h	1CA8h	FloatIEEE754	0.00537056928 V	0 V

The variable service is controlled with the following buttons:



-  **Show/Hide Details** Additional information for each parameter, such as unique parameter ID (UPID), scaling, min/max value, can be displayed on demand.
-  **Read Variable:** Reads the selected variable from the drive once.
-  **Write Variable:** Writes the selected variable to the drive.
-  **Read All Variables:** Reads from the drive all variables of the section once.
-  **Read All Variables Cyclically:** Reads from the drive all variables of the section cyclically.
-  **Remove (Del):** Removes the selected variable from the list.

The following buttons are only used in special cases.

-  **Edit Properties** The parameter properties can be displayed and changed.
-  **New ... Variable** In a new generated variable section a new variable can be defined. This is a drop down menu, which supports different variable types.


-  **New Bit Variable** In a new generated variable section a variable of the type bit can be defined.
-  **New String Variable** In a new generated variable section a variable of the type string can be defined.
-  **New Float32** In a new generated variable section a variable of the type float32 can be defined.
-  **New With UPID** In a new generated variable section a variable can be added by using the UPID from the appropriate parameter.

Under “User Defined” any variables or parameters can be arranged together. Typically the variables are selected via UPID. It is also possible to drag and drop them from the parameter or variable section.

## 2.9 Command Table

The drive supports the command table (CT) functionality, which means a set of up to 255 motion commands (31 commands for B1100GP and B1100VF series drives, on B1100PP CT is not supported) can be stored in this table.

An example of is shown in the following picture:

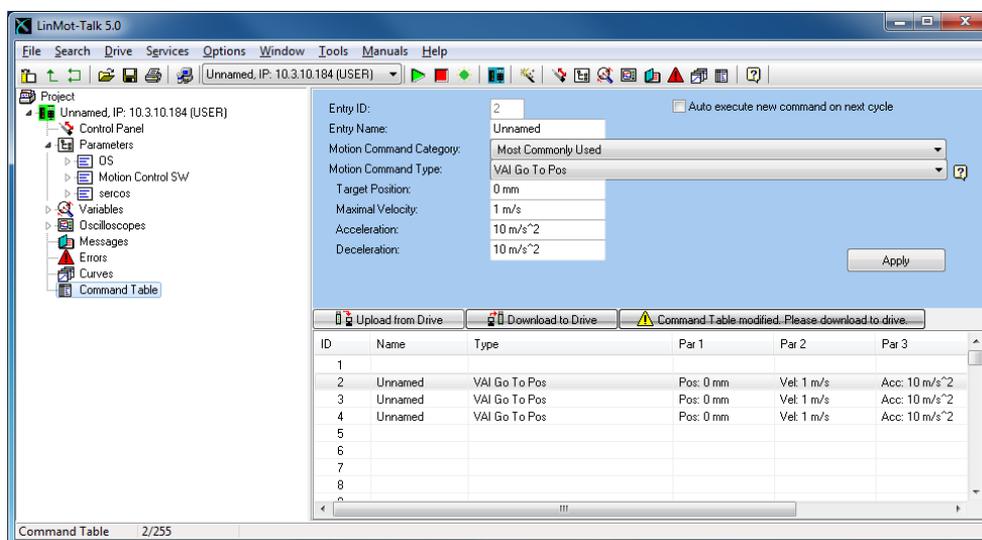

A big variety of commands can be set in this tables, such as motion commands, conditions, sequence directives, parameter access, ...

This makes the CT to very powerful functional unit. The CT entries can be accessed (executed) via digital inputs (on X6) or via interface software.

The CT tool has the following editing elements:


- **Entry ID** indicates the CT entry, which is being edited.
- **Entry Name** is a descriptive string of max. 16 characters
- **Motion Command Category** the available commands are fitted into groups for keeping a better overview
- **Motion Command Type** specifies the command to be executed in this entry.

- **Auto execute new command on next cycle** when selected, on the next cycle the entry specified under “ID of Sequenced Entry” will be executed. This gives the possibility of defining cycles, simple logical sequences.
- **ID of Sequenced Entry** defines the CT entry executed on the next cycle when “Auto execute new command on next cycle” is activated.
- **Apply** writes the edited values into the entry.
- **Upload from Drive** reads and displays the entire command table from the drive.
- **Download to Drive** writes the edited table (from the PC) to the drive.

An application example of the CT can be found in the motion control software user manual (Usermanual\_MotionCtrlSW\_E1100.pdf).

## 2.10 Access Codes

On the drive special features or customer specific applications can be protected by a software key. This means, a key must be activated by an access code, which is drive specific (pinned to the serial number). Under Drive\Set Access Code\ the following window will open:

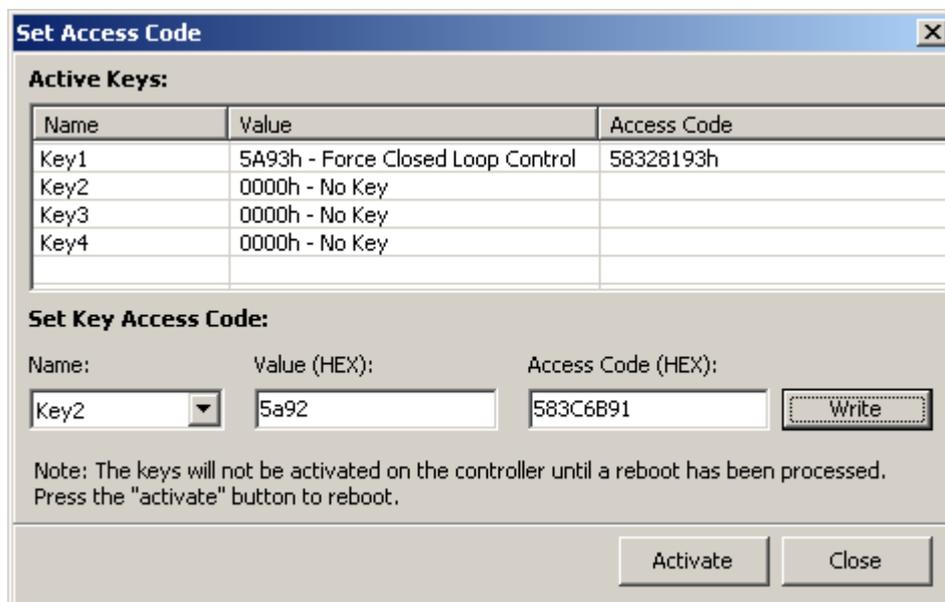

Name	Value	Access Code
Key1	5A93h - Force Closed Loop Control	58328193h
Key2	0000h - No Key	
Key3	0000h - No Key	
Key4	0000h - No Key	

**Set Key Access Code:**

Name:  Value (HEX):  Access Code (HEX):

Note: The keys will not be activated on the controller until a reboot has been processed. Press the "activate" button to reboot.

A maximum of four keys can be set on the drive. Under Active Keys all valid installed keys are listed (key value and access code).

A new key can be set by selecting the key name and defining the value and access code. With the write button, the key and access code are written to the drive. As soon as the drive has rebooted (click the Activate button) the new key will be active, if the access code fits.

Please note: Access codes are drive specific. They cannot be copied from one drive to another.

The following table shows on which drives the different functions are available:

Legend:

S: Standard Function

TF: Technology Function, can be enabled with key

NA: Function not available


Technology Functions	Curve	Force Control
E1100	S	TF
B1100	TF	TF
B1150ML	TF	TF
E1200	S	TF
E1400V2	S	TF
A1100	S	TF
C1100	S	TF
C1200	S	TF
C1400	S	TF
D1400	S	NA

### 3 Quick Start Guide

This chapter helps step by step to set up a system using servo drive and the LinMot-Talk configuration software.

#### 3.1 Cabling E1100


The following picture shows the connectors on the drive used for a first commissioning (with PC only).

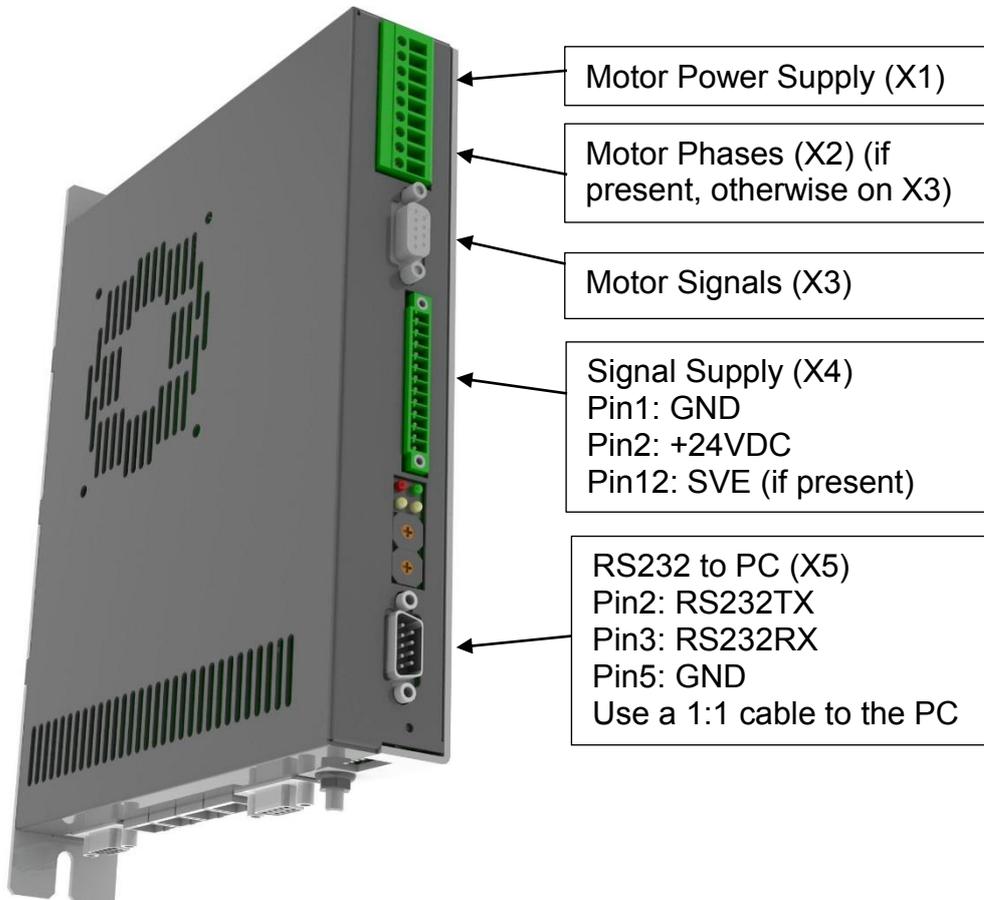

- **X1** Motor Supply, use 48..72 VDC (between PWR+ and PGND).
- **X2** Motor Phases: if this connector is not present, connect the motor on X3 only.
- **X3** Motor signals: if motor has a DSUB-9 connector, connect it directly, otherwise use an adapter to DSUB-9 or wire the phase lines to X2.
- **X4** For a commissioning with the PC it is necessary to wire only the Pin1 (GND), Pin2 (+24VDC) and, if present, Pin12 save voltage enable (SVE, +24VDC).
- **X5** RS232: The cable between the LinMot drive and PC must be DSUB-9 F/F, 1:1 (X modem). If the PC has no COM port available, use the USB to RS232 converter (LinMot article number 0150-3110).

### 3.2 Cabling E1200


The following picture shows the connectors on the drive used for a first commissioning (with PC only).

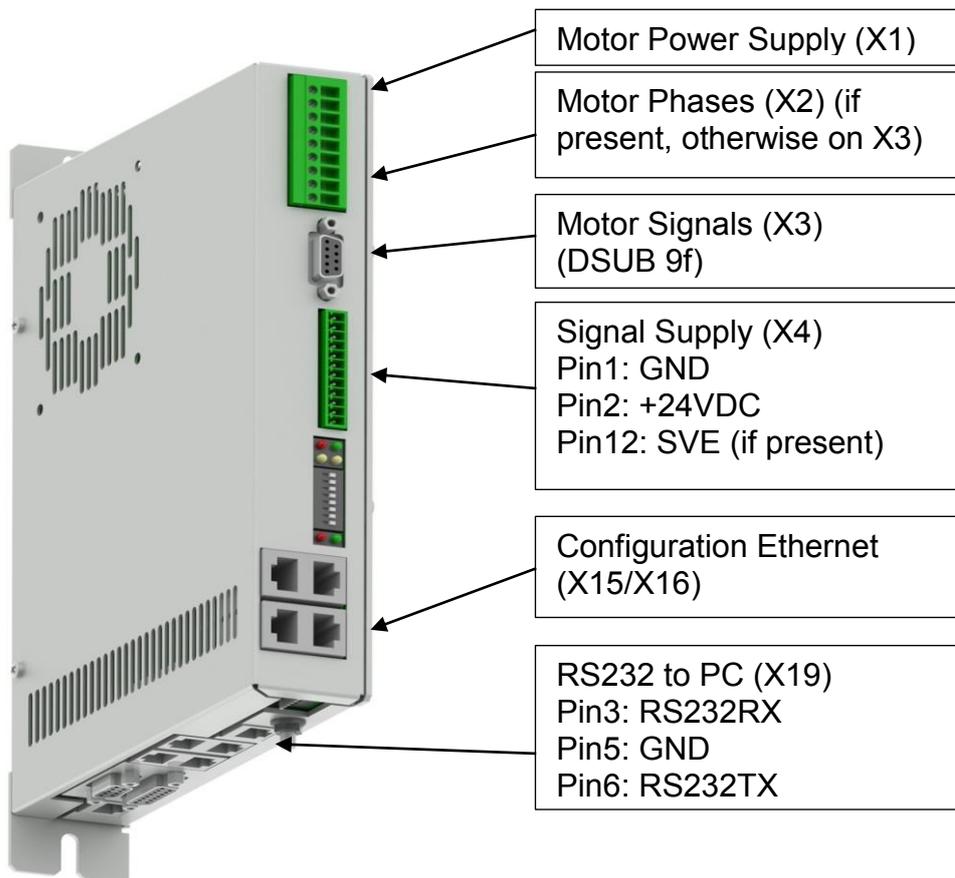

- **X1** Motor Supply, use 48..72 VDC (between PWR+ and PGND).
- **X2** Motor Phases.
- **X3** Motor Signals. (Note: the motor phases are not present on this connector. Thus wire the motor phases in any case to X2).
- **X4** For a commissioning with the PC it is necessary to wire only the Pin1 (GND), Pin2 (+24VDC) and, if present, Pin12 save voltage enable (SVE, +24VDC).
- **X15/X16** Ethernet: Use a standard RJ45 patch cable to wire to the LAN.
- **X19** RS232: Use the RS232 PC configuration cable (LinMot article number 0150-2143) to connect your PC via RS232. If the PC has no COM port available, use the USB to RS232 converter (LinMot article number 0150-3110).

### 3.3 Cabling E1400


The following picture shows the connectors on the drive used for a first commissioning (with PC only).

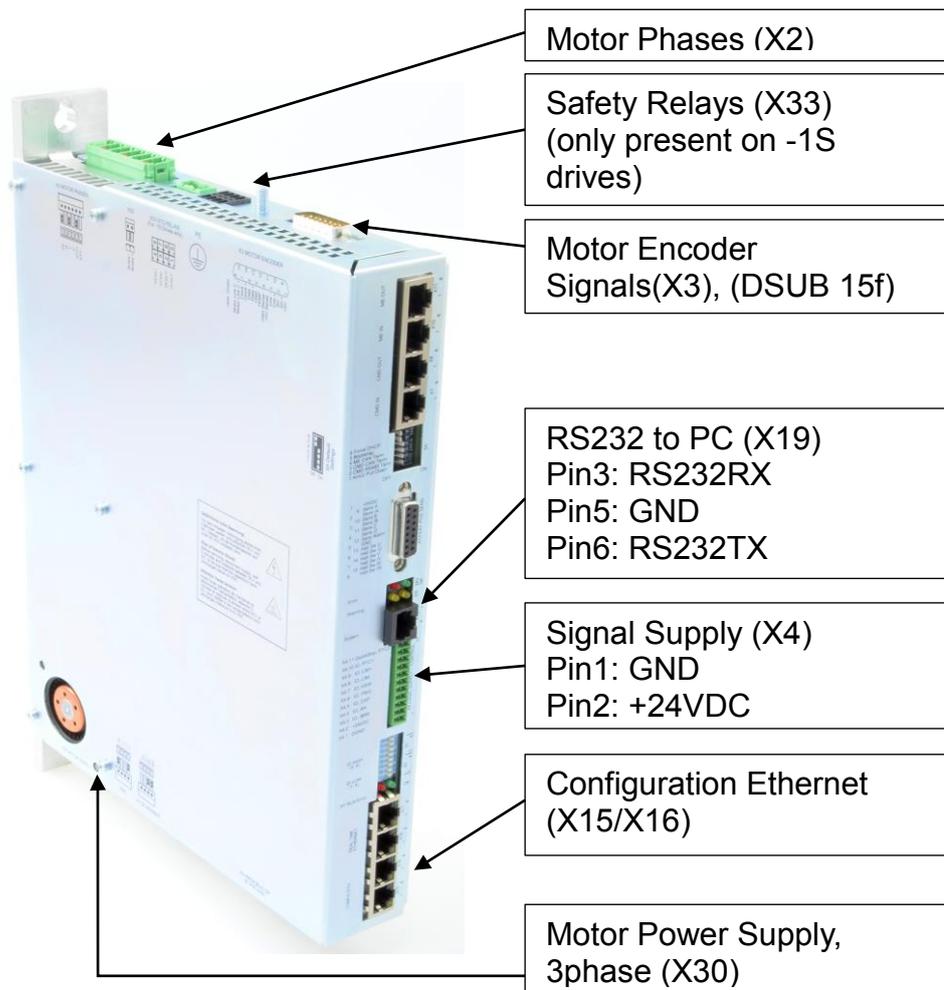

- **X2** Motor Phases.
- **X3** Motor Encoder Signals.
- **X4** For a commissioning with the PC it is necessary to wire only the Pin1 (GND) and Pin2 (+24VDC).
- **X15/X16** Ethernet: Use a standard RJ45 patch cable to wire to the LAN.
- **X19** RS232: Use the RS232 PC configuration cable (LinMot article number 0150-2143) to connect your PC via RS232. If the PC has no COM port available, use the USB to RS232 converter (LinMot article number 0150-3110).
- **X30** Motor Supply, use 3x400 / 3x480VAC 50/60 Hz
- **X33** Safety Relays: For the safety relays use a separate +24VDC supply. For a commissioning it is necessary to wire both Ksr+ (X33.4 and X33.8) to +24 VDC and both Ksr- (X33.3 and X33.7) to GND.

### 3.4 Cabling B1100


The following picture shows the connectors on the drive used for a first commissioning (with PC only).

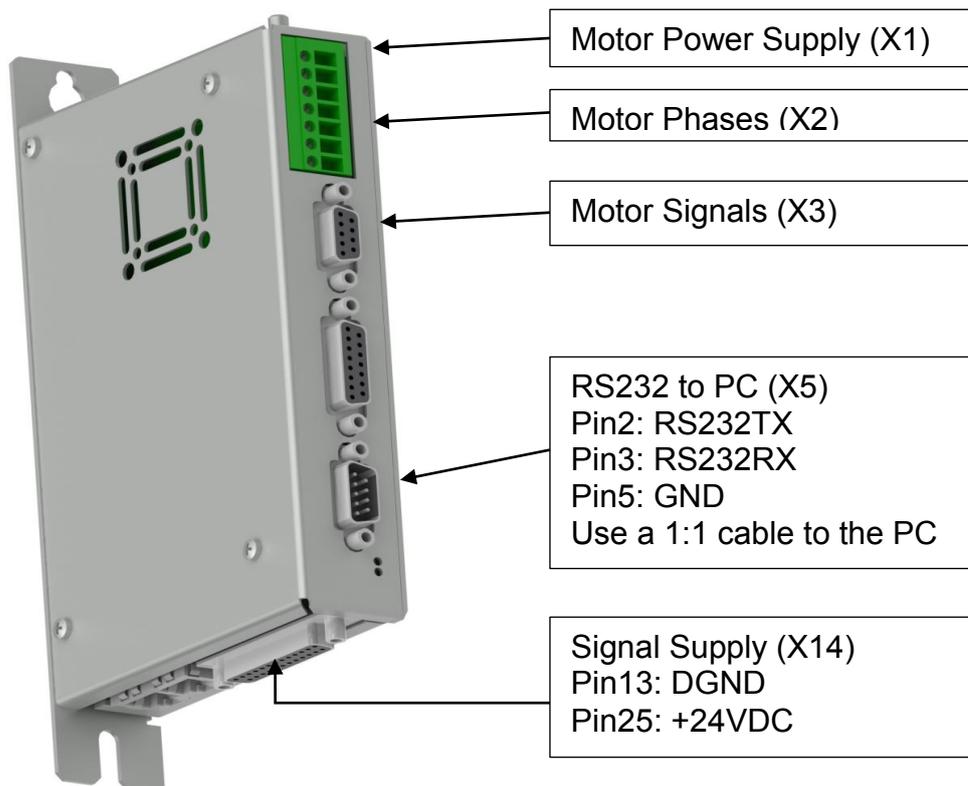

- **X1** Motor Supply, use 48..72 VDC between (PWR+ and PGND).
- **X2** Motor Phases
- **X3** Motor signals: if motor has a DSUB-9 connector, connect it directly, otherwise use an adapter to DSUB-9 or wire the phase lines to X2.
- **X5** RS232: The cable between the LinMot drive and PC must be DSUB-9 F/F, 1:1 (X modem). If the PC has no COM port available, use the USB to RS232 converter (LinMot article number 0150-3110).
- **X14** For a commissioning with the PC it is necessary to wire only the Pin13 (DGND) and Pin25 (+24VDC).


### 3.5 Cabling B8050-ML

The following picture shows the connectors on the drive used for a first commissioning (with PC only).

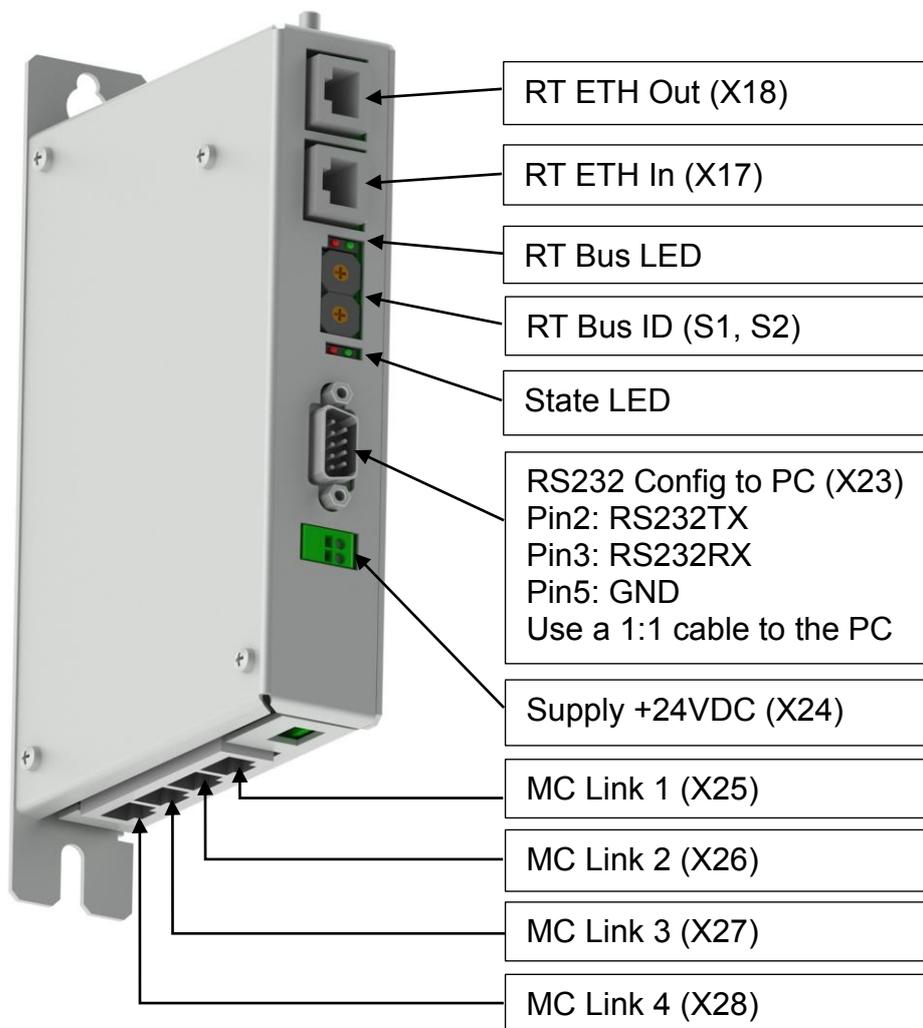


- **X23 RS232:** The cable between the LinMot drive and PC must be DSUB-9 F/F, 1:1 (X modem). If the PC has no COM port available, use the USB to RS232 converter (LinMot article number 0150-3110).
- **X24** Use a 24V switched power supply.

### 3.6 Cabling A1100

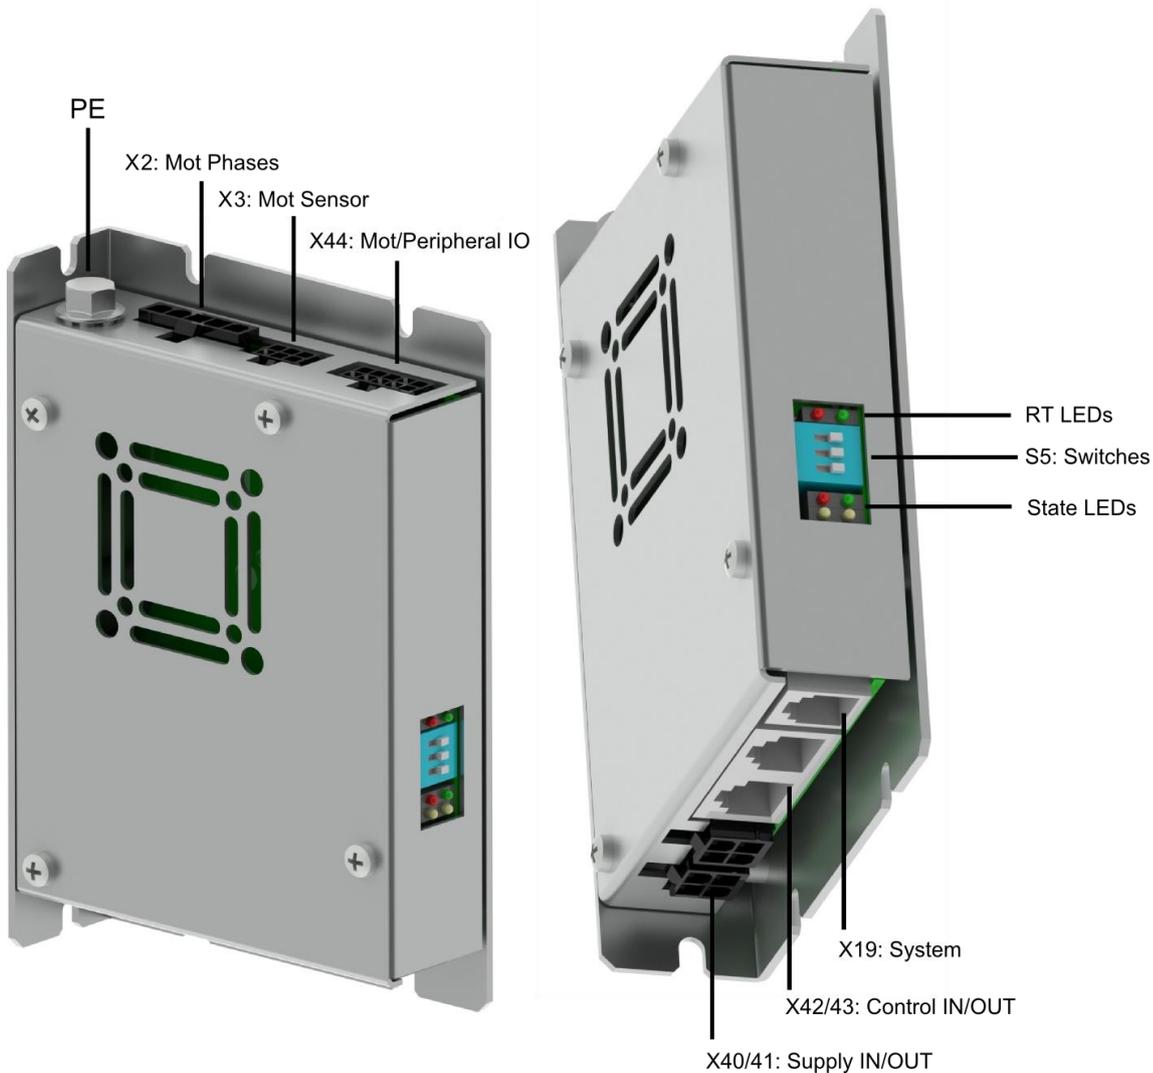


- **X2** Motor Phases.
- **X3** Motor Signals.
- **X19** RS232: Use the RS232 PC configuration cable (LinMot article number 0150-3544) to connect your PC via RS232. If the PC has no COM port available, use the USB to RS232 converter (LinMot article number 0150-3110).
- **X40** Wire Pin1 (GND) and Pin2 (+24VDC) for signal supply, and for motor supply, use 48..72 VDC for PWR+ on Pin4 and PGND is on Pin3. (Linmot provides a connector with the crimped 1.5m long wires as a product under the article number 0150-3545.)

## 3.7 Cabling C1100

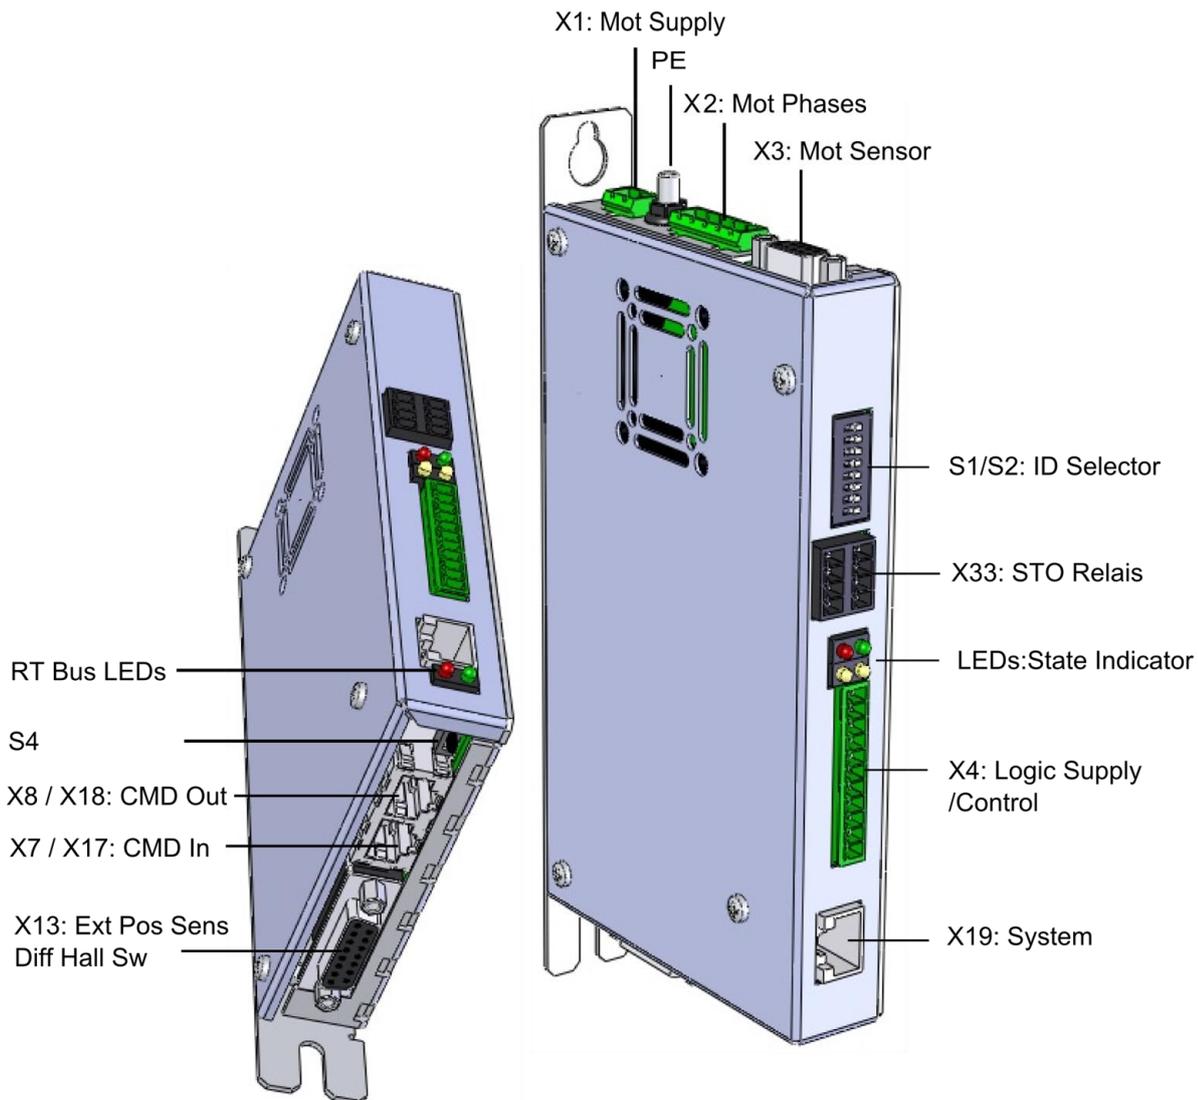


- **X1** Motor Supply, use 48..72 VDC (between PWR+ and PGND).
- **X2** Motor Phases.
- **X3** Motor Signals. (Note: the motor phases are not present on this connector. Thus wire the motor phases in any case to X2).
- **X4** For a commissioning with the PC it is necessary to wire only the Pin1 (GND) and Pin2 (+24VDC).
- **X19** RS232: Use the RS232 PC configuration cable (LinMot article number 0150-2143) to connect your PC via RS232. If the PC has no COM port available, use the USB to RS232 converter (LinMot article number 0150-3110).
- **X33** Safety Relays: The connector X33 is only present for 1S safety functionality. For the safety relays use a separate +24VDC supply. For a commissioning it is necessary to wire both Ksr+ (X33.4 and X33.8) to +24 VDC and both Ksr- (X33.3 and X33.7) to GND.

## 3.8 Cabling C1200

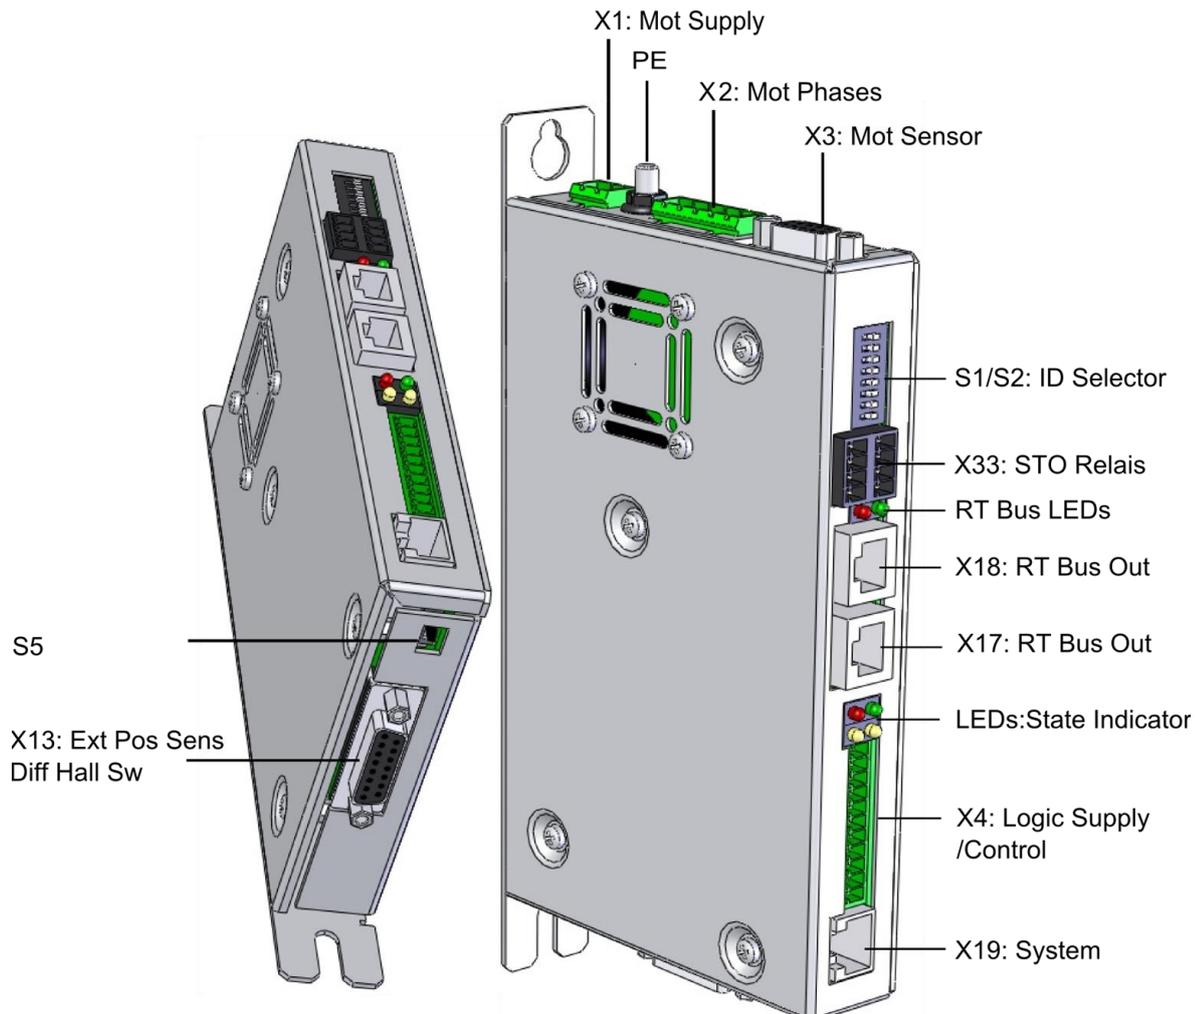

- **X1** Motor Supply, use 48..72 VDC (between PWR+ and PGND).
- **X2** Motor Phases.
- **X3** Motor Signals. (Note: the motor phases are not present on this connector. Thus wire the motor phases in any case to X2).
- **X4** For a commissioning with the PC it is necessary to wire only the Pin1 (GND) and Pin2 (+24VDC).
- **X19** RS232: Use the RS232 PC configuration cable (LinMot article number 0150-2143) to connect your PC via RS232. If the PC has no COM port available, use the USB to RS232 converter (LinMot article number 0150-3110).
- **X33** Safety Relays: The connector X33 is only present for 1S safety functionality. For the safety relays use a separate +24VDC supply. For a commissioning it is necessary to wire both Ksr+ (X33.4 and X33.8) to +24 VDC and both Ksr- (X33.3 and X33.7) to GND.

## 3.9 Cabling M8000

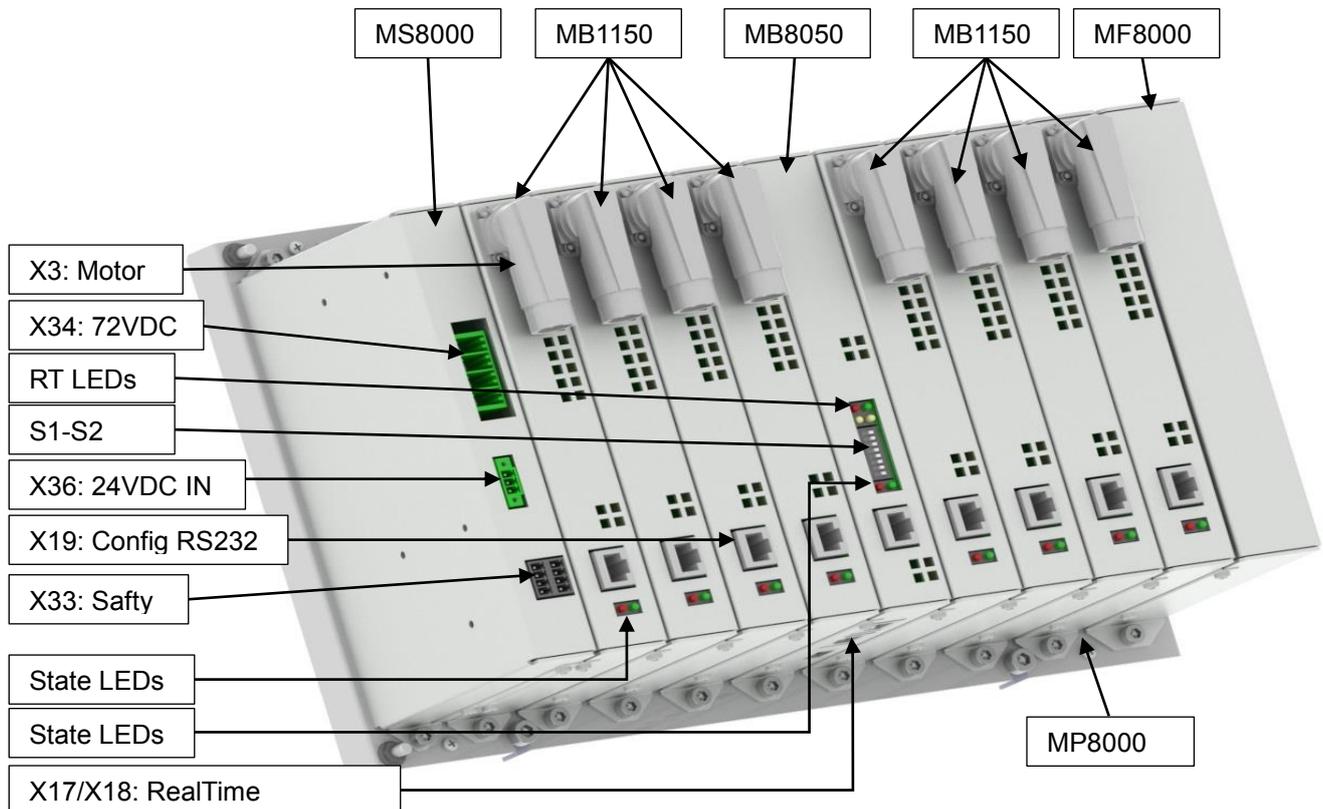

- **X3 Motor:** This is the only connector to the motor, it includes the phases and signals.
- **X19 RS232:** Use the RS232 PC configuration cable (LinMot article number 0150-2143) to connect your PC via RS232. If the PC has no COM port available, use the USB to RS232 converter (LinMot article number 0150-3110).
- **X33 Safety Relays:** The connector X33 is only present for 1S safety functionality. For the safety relays use a separate +24VDC supply. For a commissioning it is necessary to wire both Ksr+ (X33.4 and X33.8) to +24 VDC and both Ksr- (X33.3 and X33.7) to GND.
- **X34 Motor Supply,** use 48..72 VDC (between PWR+ and PGND). The Axis 1-4 and 5-8 are supplied separately.
- **X36:** For a commissioning with the PC it is necessary to wire only the Pin1 (GND) and Pin2 (+24VDC).

### 3.10 Firmware Download

As the cabling is done correctly now, turn on the drive's power and start up the LinMot-Talk software. Before using the drive the first time, the firmware has to be downloaded. Therefore press install firmware button  to start the wizard. Choose the file "Firmware\_Build20101126.sct" (or similar) and press "Open". Then the wizard will start and guide through the installation.

In case of installing the firmware over ETHERNET, the service password is required. This is for safety reasons. Especially if there are a lot of drives accessible in the network, it can easily happen to confound them. Thus it is strongly recommended to set a password. By default no password is set. If the password is unknown, the parameters can be set to default by hex switches, see [4.1](#). Installing the firmware over ETHERNET is only possible on drives with a separate Config Ethernet (E1200 and E1400). Installation over RT Ethernet is not possible.

According to the drive type, different interfaces and application software can be selected.

The following tables show the compatibility of drive type, interfaces and applications.

Legend:

- D: Programmed as default
- X: Can be selected
- P: Planned
- GW: Gateway Software
- 6.3: Until Software Build 6.3
- ML: Motion Link Version


Drivetypes / Interfaces / Applications	None	MC Link	CT interface	LinRS	CO	DN	DP	EtherCAT	SoE	CIA402	PN	PD	PL	SC	IP	LinUDP V1	LinUDP V2	None	EasySteps	EasyStepsX6	MasterSlave	AutoStart	Sinoide
A1100-GP	X				D													D				X	X
C1100-GP	X			X	D													D	X			X	
C1150-DS										D								D	X			X	
C1150-EC								D										D	X			X	
C1150-PD												D						D	X			X	
C1150-PN											D							D	X			X	
C1150-SE									D									D	X			X	
C1250-DS										D								D	X				
C1250-EC								D										D	X				
C1250-IP															D	6.3		D	X				
C1250-LU																	D	D	X				
C1250-PD												D						D	X				
C1250-PL													D					D	X				
C1250-PN											D							D	X				
C1250-SC														D				D	X				
C1250-SE									D									D	X				
E1200-GP	X			X	D													D	X		X		
E1230-DP							D											D	X		X		



### 3.11 Login

When successfully finished downloading the firmware, login with \File>Login..., then select the appropriate port and press ok. A login info window will appear showing the login progress.


When logged in you will find the following window:

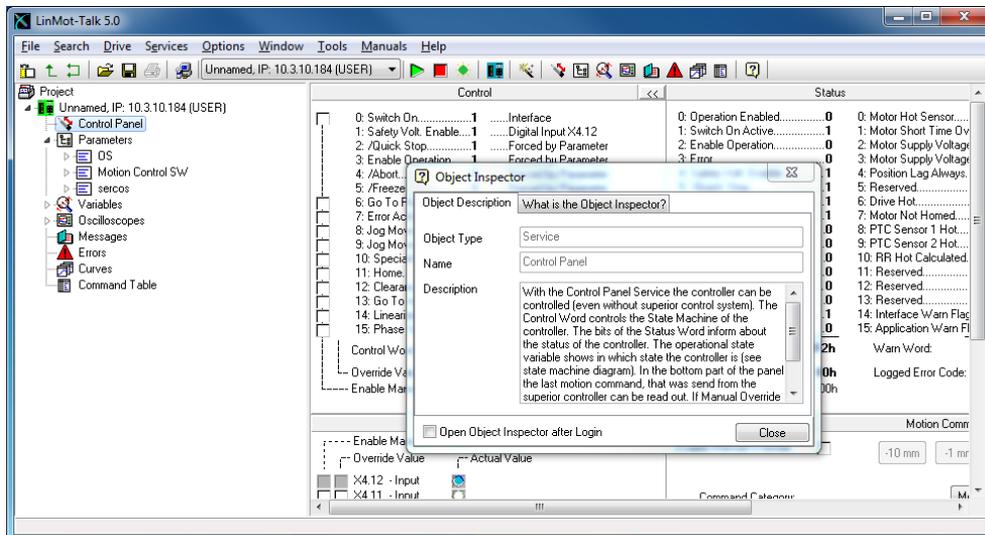

The Object Inspector window can be dragged away or closed. It can be reopened with F1.

### 3.12 Scanning CAN Bus

When one or several drives are linked with CAN bus for configuring, it can be very helpful to scan the CAN bus for linked drives automatically. Thus, it is not necessary to know all node IDs. Under \File>Scanning (with CANusb) a list of the present drives will be displayed:

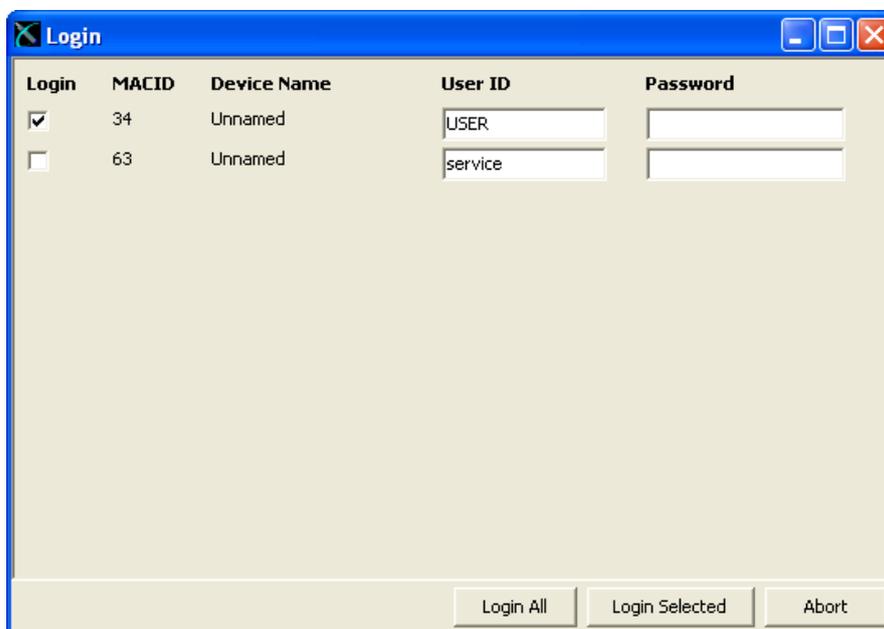


With just one click the LinMot-Talk software will log in to all drives.

### 3.13 Scanning Ethernet

When one or several drives are linked with Ethernet for configuring, it is helpful to scan automatically for linked drives. Thus, it is not necessary to know all node IP addresses. Under \File\Scanning (via Ethernet) first the interface has to be selected (network link)

With the radio button Group Number could be activated a scan for a special drive group. The list will only display the drives with the group number, like the number in the text field. In the drives this number is saved in the parameter with the name Net Group and the UPID 0078h.

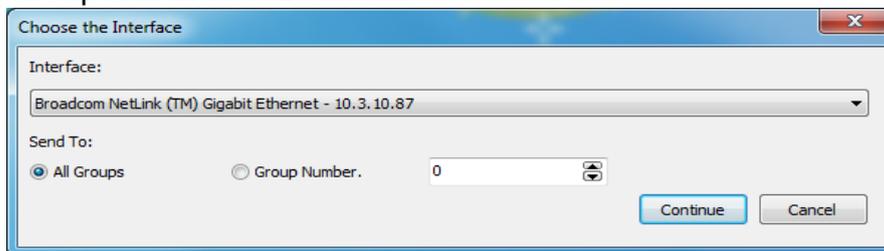

A list of the present drives will be displayed:

State	IP Address	MACID	Group	Device Name	Device Type	Release Info	User ID	Password
	10.3.10.22	00:1A:HE:00:10:5C	0	Lagertest1	E1400-GP-QN /IRB	4.4 Build 20120130	USER	
	10.3.10.61	00:1A:HE:00:1A:5C	0	Flo's E1250-SC	E1250-SC-UC/VIRE	4.4 Build 20120130	USER	
	10.3.10.66	00:1A:HE:00:0A:AA	0	KMT Referenzantrieb		4.3 Build 20110901	USER	
	10.3.10.67	00:1A:HE:00:0D:80	0	MotEnd		4.2 Beta 20110211	USER	
	10.3.10.82	00:1A:HE:00:05:0C	0	Flo's E1250-PL	E1250-PL-UC/VIRD	4.4 Build 20120130	USER	
	10.3.10.93	00:1A:HE:00:02:2A	0	MM_E1250_EC_UC	E1250-EC-UC/VIRC	5.0 Beta 20120514	USER	
	10.3.10.106	00:1A:HE:00:10:14	0	MM_E1450_SC	E1450-SC-QN /IRB	5.0 Beta 20120514	USER	
	10.3.10.107	00:1A:HE:00:22:2C	0	KHS Teststand	E1400-GP-QN /IRD	5.0 Beta 20120514	USER	
	10.3.10.108	00:1A:HE:00:06:78	0	Flo's E1250-IP	E1250-IP-UC/VIRE	4.4 Build 20120130	USER	
	10.3.10.109	00:1A:HE:00:02:48	0	Ludo Desk	E1200-GP-UC/VIRC	4.4 Build 20120130	USER	
	10.3.10.123	00:1A:HE:00:10:0C	0	Unnamed	E1450-IP-QN /IRB	5.0 Beta 20120514	USER	
	10.3.10.127	00:1A:HE:00:2B:08	0	Unnamed	E1250-PN-UC/VIRE	5.0 Beta 20120702	USER	
	10.3.10.129	00:1A:HE:00:1B:B8	0	Laser3 - Laser_X	E1250-EC-UC/VIRE	4.4 Build 20120130	USER	
	10.3.10.132	00:1A:HE:00:1B:BA	0	Laser3 - Laser_Z	E1250-EC-UC/VIRE	4.4 Build 20120130	USER	
	10.3.10.137	00:1A:HE:00:02:24	0	MM_E1250_PL_UC	E1250-PL-UC/VIRC	4.4 Build 20120130	USER	
	10.3.10.143	00:1A:HE:00:22:30	0	QS_TestCtr	E1400-GP-QN /IRD	5.0 Beta 20120514	USER	
	10.3.10.179	00:1A:HE:00:10:0A	0	Unnamed	E1400-GP-QN /IRB	4.4 Build 20120130	USER	
	10.3.10.184	00:1A:HE:00:03:4E	0	Unnamed	E1250-SC-UC/VIRD	5.0 Build 20120710	USER	
	10.3.10.186	00:1A:HE:00:10:24	0	Unnamed	E1450-EC-QN /IRB	4.4 Build 20120130	USER	
	10.3.10.191	00:1A:HE:00:10:40	0	Lagertest3	E1400-CP-QN /IRB	4.4 Build 20120130	USER	

With just one click the LinMot-Talk software will log in to all drives. The colored markings have the following meaning:


- Green: The drive is ready to log in.
- Grey: You are already logged into this drive.
- Red: Another instance is logged into this drive (other user or other interface).

The default mode for acquiring an IP address is via DHCP. If no servers on the connected network respond, the drive switches to the Ipv4 Link-Local addressing scheme (also known as APIPA on Windows systems). This way the drive automatically assigns itself an address within the range of 169.254.0.1 through 169.254.255.254 (Subnet Mask 255.255.0.0).


Please note that this process can take up to a minute until a valid address is assigned to the drive this way.

### 3.14 Motor Wizard

As no motor is defined, the next step is to start the motor setup wizard. Press the button  and the following window will appear:

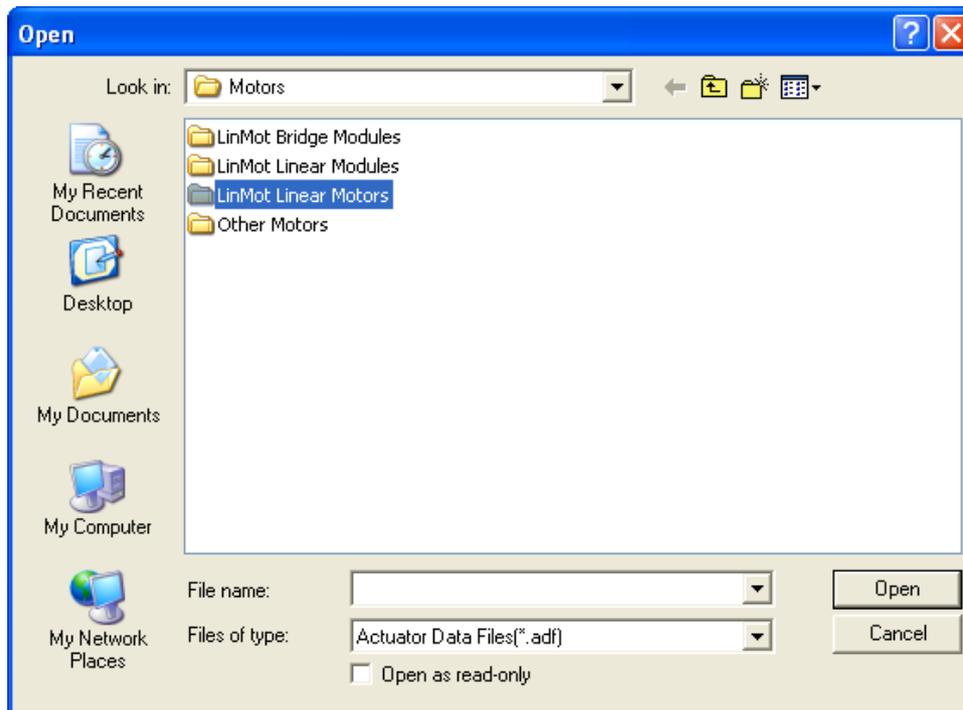

As we want to configure a LinMot Motor we choose “LinMot Linear Motors” and press Open.

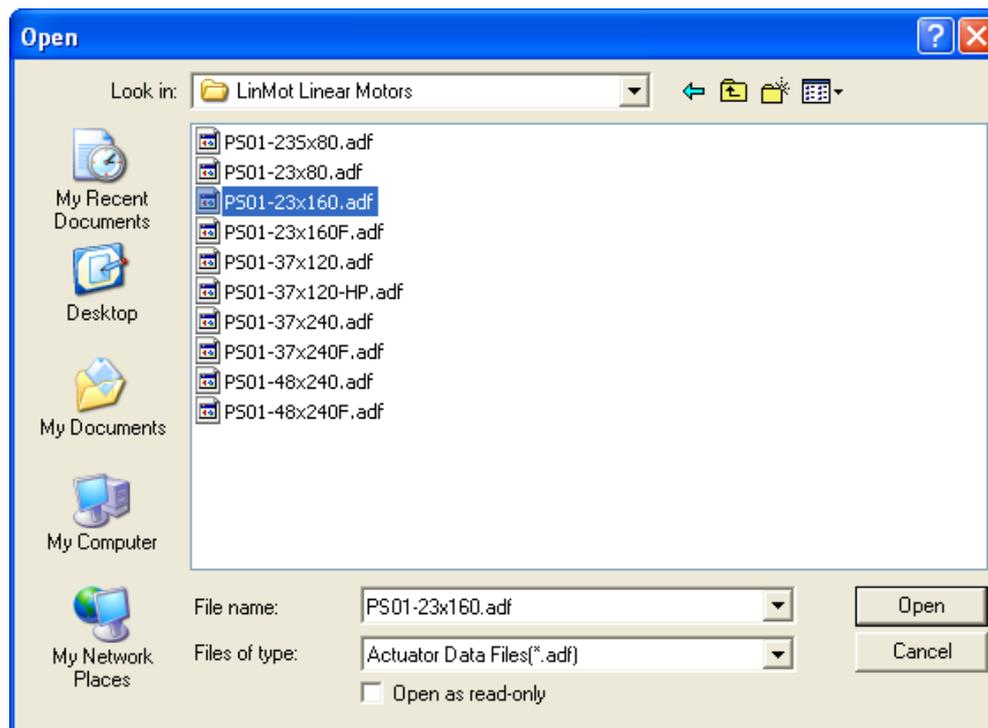


Select the actuator type you have connected to the drive, then press Open. The following steps will show forms including drawings and descriptive texts. The first step is to define the stator and slider.






With step 5 the feed forward parameters are set up. Depending on the moving mass, additional load mass, friction and orientation. Under the derived settings the influence can be watched.

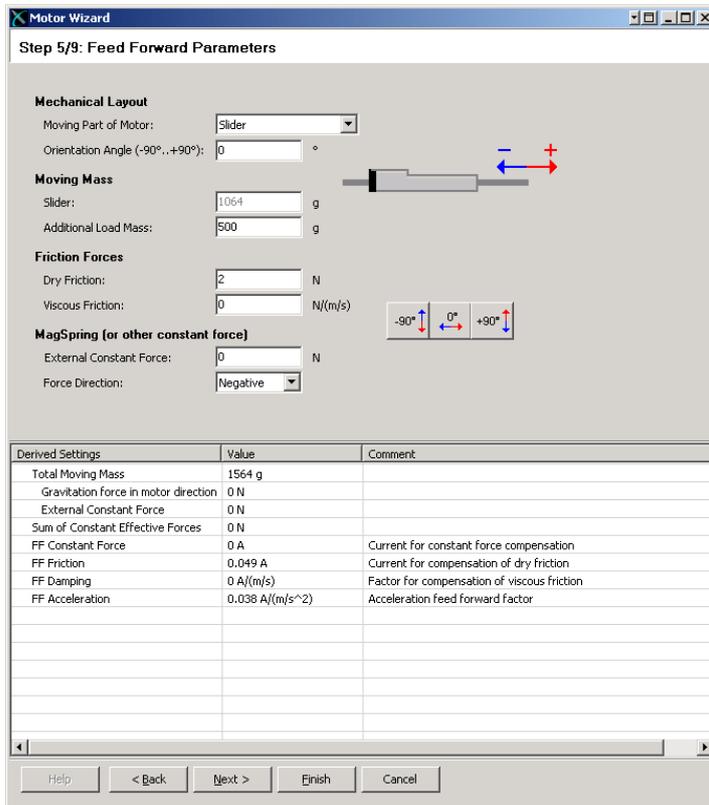

With the next and last step the position drive's parameters will be set up:

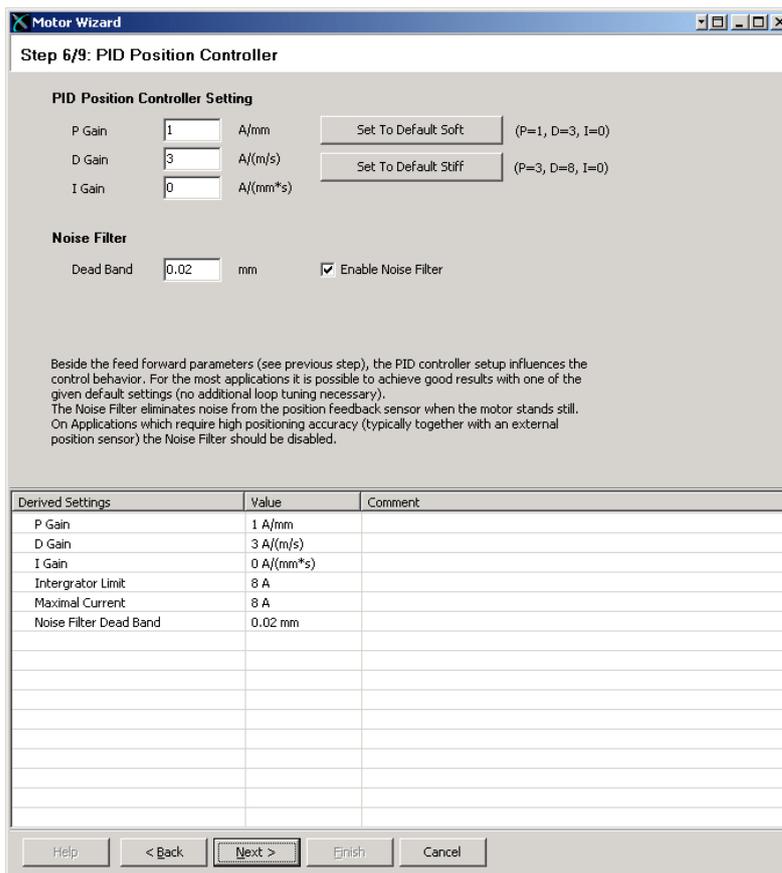

It is recommendable to start with the default soft settings, because the parameters can be changed any time later on (by restarting the motor wizard or by setting in the parameter tree directly).

With the soft parameter setting, PID values will be quite low such as the motor is low noise and the position is not controlled very stiffly.


The stiff parameter set tends to more noise and more power consumption of the motor, but the position will be controlled harder.

In both settings, the I Gain is set to zero, which means a steady-state deviation from the desired position can occur. When using the I Gain, the position controller may tend to swing.

The Noise Filter option is to reduce the noise from the position feedback sensor at standstill.

For finding the best set of PID parameters, the system has to be optimized iteratively. There is no general way of how to optimize the settings, because different goals can be achieved such as position accuracy, power minimization, noise reduction, ...


The next step is to define the homing procedure.

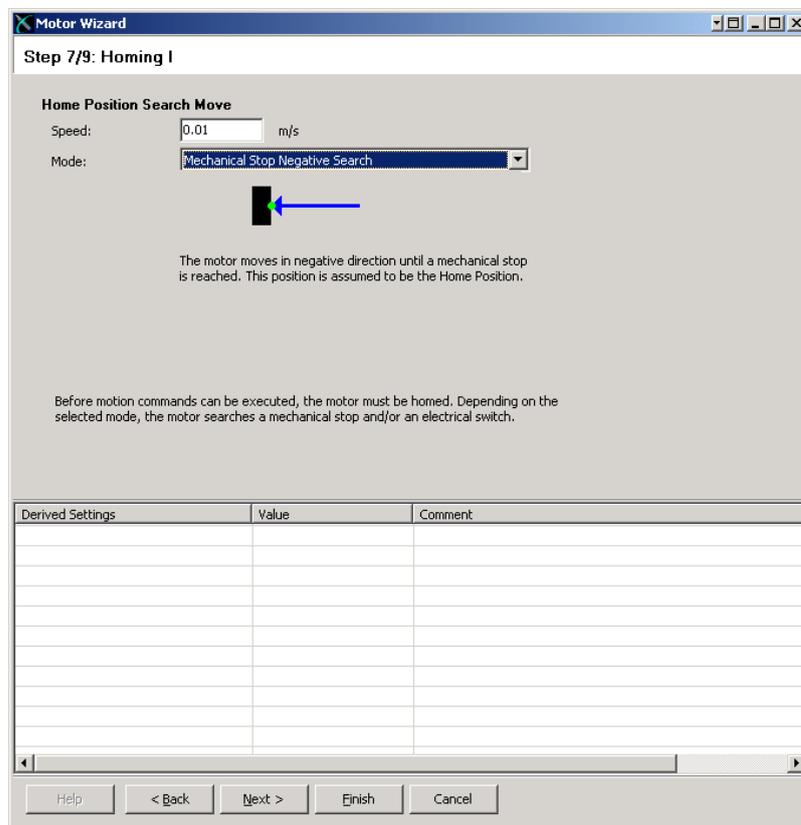


The most frequently used homing mode is “Mechanical Stop Negative Search”. In this case the slider will move with the notch towards the stator’s front end (where no cable is).

Other modes support homing on home switches, limit switches, indexer inputs or some combinations of those.

Step 8 is to define the slider home position. This is for the motor and drive the most important value. It defines at the home position, where the slider is positioned relative to the stator. This defines how far the motor can move in each direction.

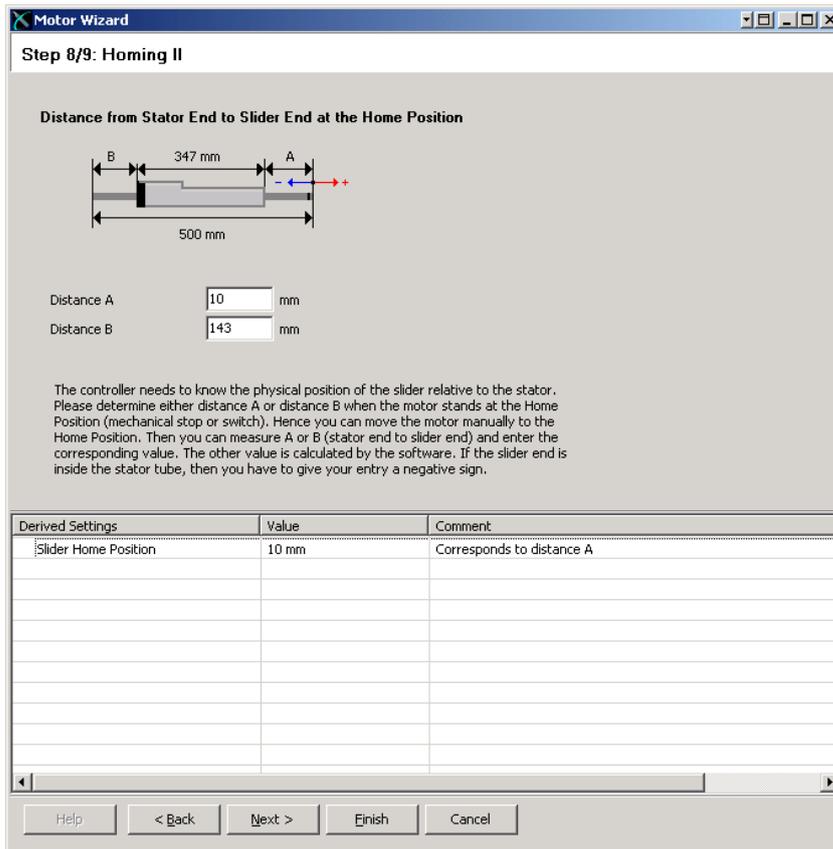

With the last wizard step the user's coordinate system can be defined.

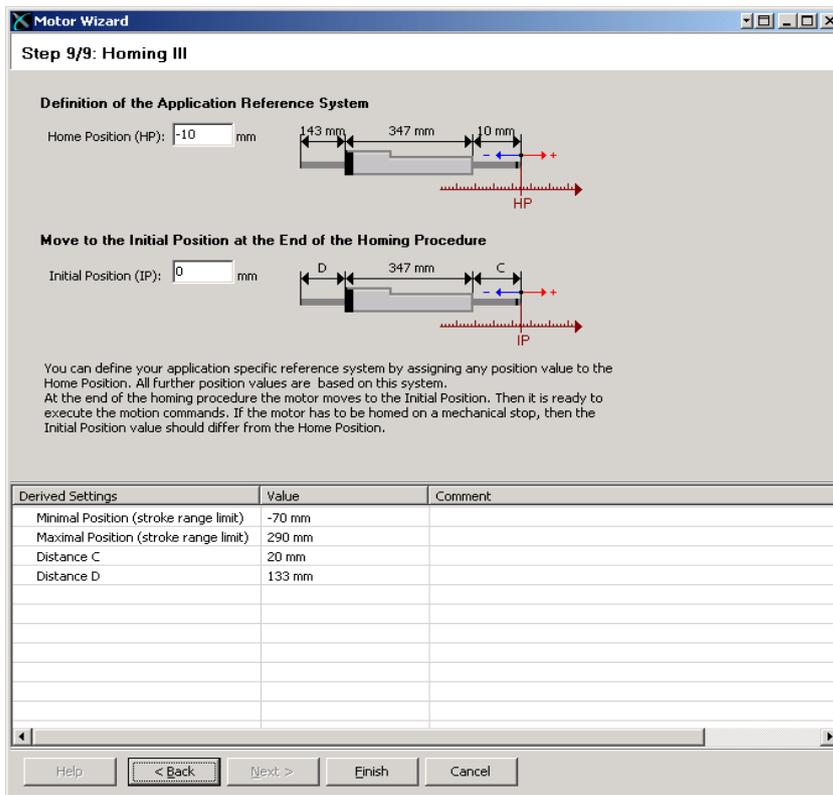

At the end, press finish. If the firmware on the drive is still running, an appropriate

message will be shown. All parameters will now being written to the drive.


The motor wizard can be run several times, e.g. to setup an external sensor, to change the load setup or to change the motor type. When rerunning it, at the end will be shown a list of parameters, which will be changed.

### 3.15 Continuous Curve Mode


We want the motor to run a curve cyclically (The easiest, but not so informative way to run the motor would be the VAI 2 Pos Continuous mode).

The drive is set to continuous curve mode by selecting “Continuous Curve” under \Motion Control SW\Motion Interface\Run Mode Settings\Run Mode Selection\ in the parameter tree.

NOTE: For enabling the curve feature on B1100 drives, it is necessary to set an access key.

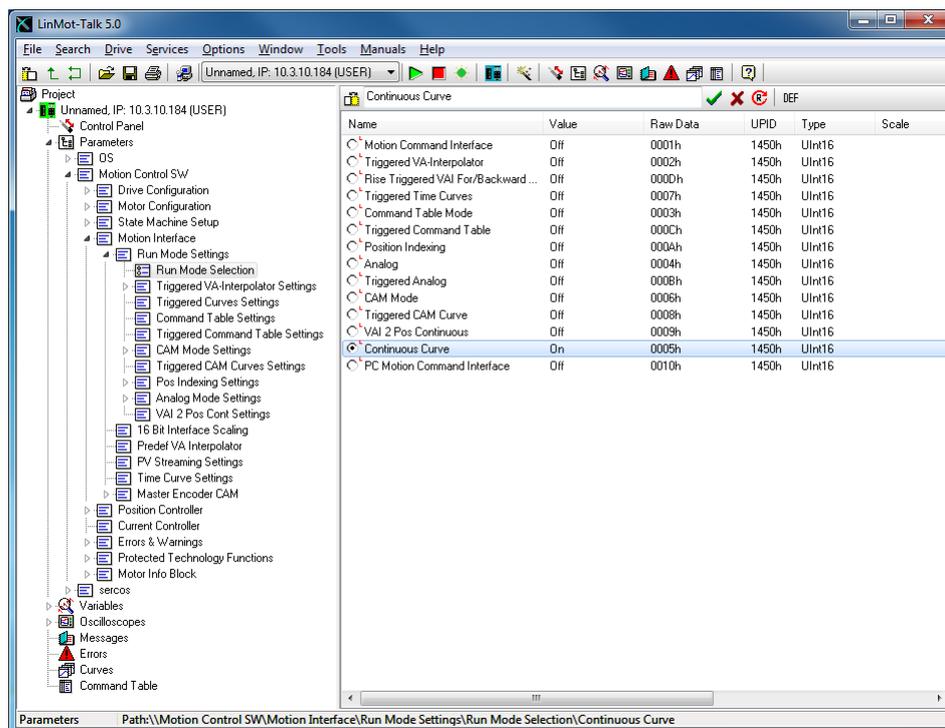

The second parameter to be set is to define which curve has to be run. Set the parameter “Curve ID” to 1 under \Motion Control SW\Motion Interface\Time Curve Settings\.

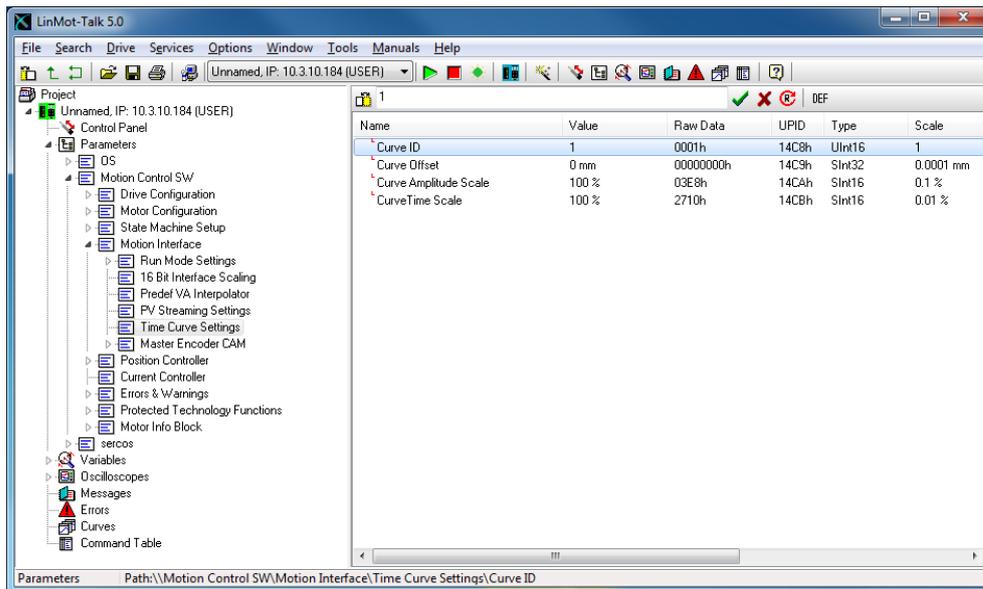


Before running the curve, it is advisable to define the curve we want to run.


### 3.16 Defining Curves

Curves can be easily defined with the curve wizard. For this example we will define two sine curve forms over a stroke of 50mm out and in with different speeds, which will be joined together.

Now, step by step: Open the curve tool by clicking the “Show Curves” button  in the tool button bar. Then press the “New Curve” button  to start the curve wizard.

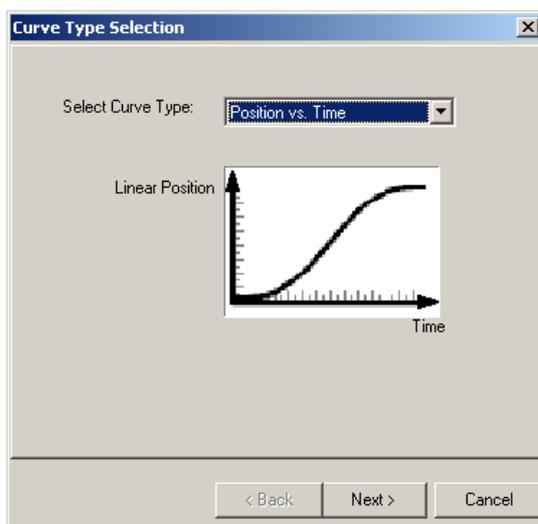

As we want to define a curve in position vs. time mode we can keep the default selection and press the next button.

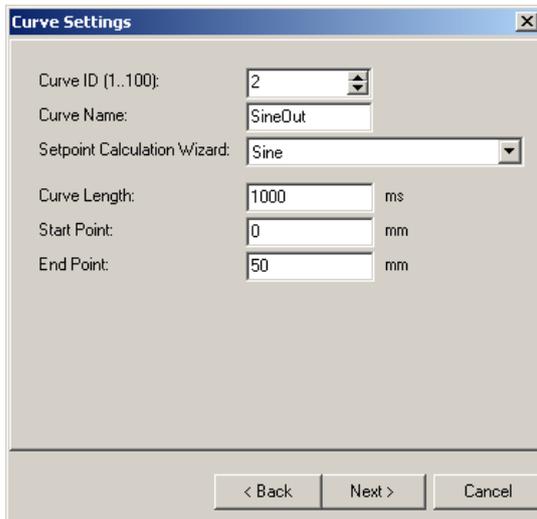


Curve Settings dialog box with the following fields:

- Curve ID (1..100): 2
- Curve Name: SineOut
- Setpoint Calculation Wizard: Sine
- Curve Length: 1000 ms
- Start Point: 0 mm
- End Point: 50 mm

Buttons: < Back, Next >, Cancel

In this mask, we will set the curve ID to 2 (we will have the merged curve with ID 1 at the end) and as name we set e.g. “SineOut”. The end point is placed at 50mm. With “Next” the wizard will show some curve data:

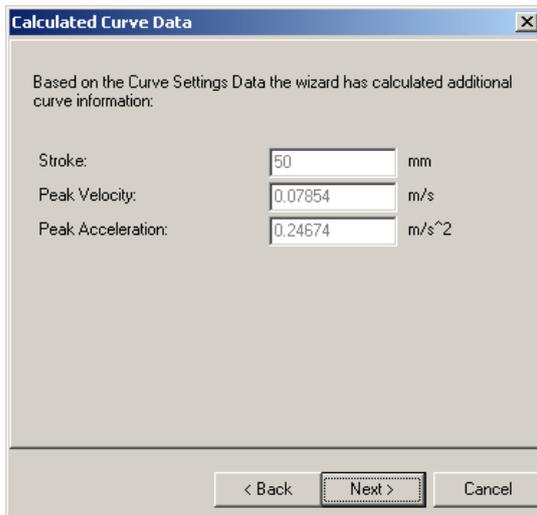


Calculated Curve Data dialog box with the following fields:

Based on the Curve Settings Data the wizard has calculated additional curve information:

- Stroke: 50 mm
- Peak Velocity: 0.07854 m/s
- Peak Acceleration: 0.24674 m/s<sup>2</sup>

Buttons: < Back, Next >, Cancel

The next and last mask proposes a number curve setpoints. It is advisable to accept this proposal.

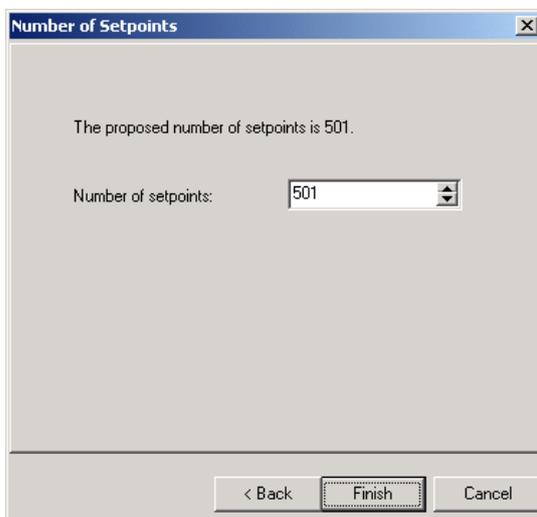


Number of Setpoints dialog box with the following fields:

The proposed number of setpoints is 501.


- Number of setpoints: 501

Buttons: < Back, Finish, Cancel

With “Finish” the first curve is defined. The curve will be displayed as follows:

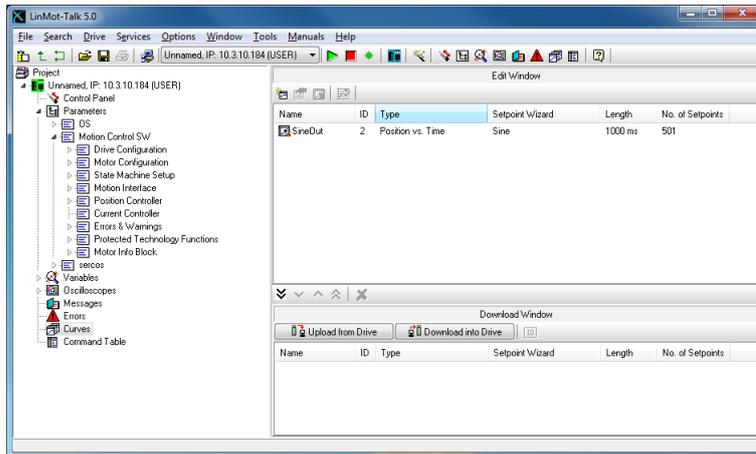


We will now define curve going back. So we start the curve wizard again and define under curve settings the following:

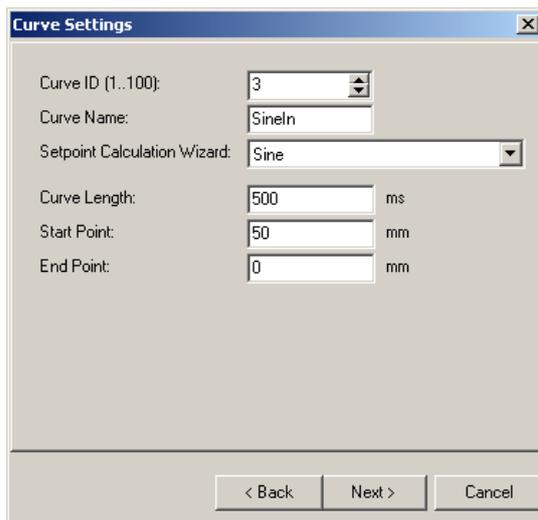


Set curve ID to 3, Curve Name to “SineIn”, Curve Length to 500ms, Start Point to 50mm and End Point to 0mm. Click twice “Next” and then “Finish”.

Now we have defined the two curve segments and will join them together. Select the two curves

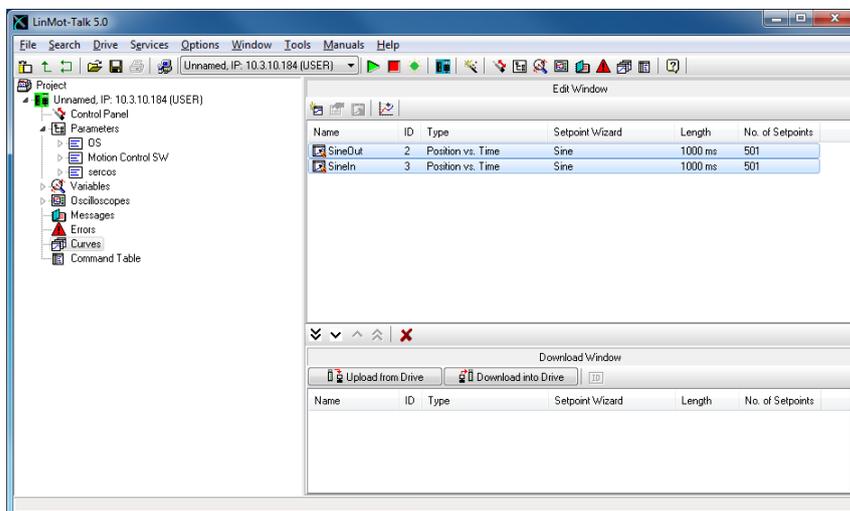

then press the “Join Curves” button . The curve settings mask for the joined curve appears:

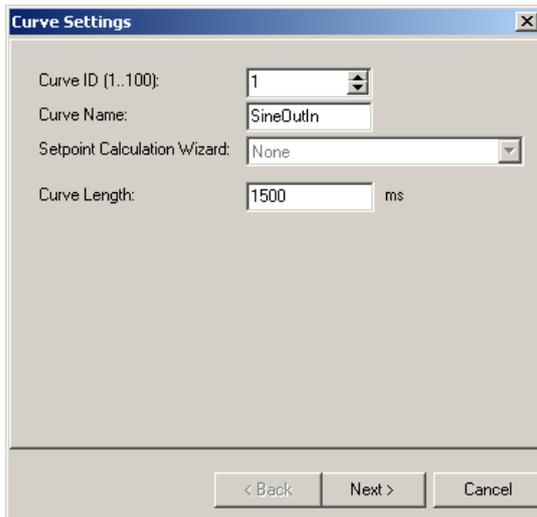


We will set the curve name to “SineOutIn” and make sure the curve ID is 1.


The curve length is proposed as the sum of the curve segment times.

Please consider the maximal number of curves and curve points indicated in chapter [2.6](#).

Press “Next” and “Finish”. The curve for the continuous curve mode is now defined and has, according to the parameter settings, the curve ID 1. As we want to download the curves to the drive we select all the curves in the edit window and move them to the download window.

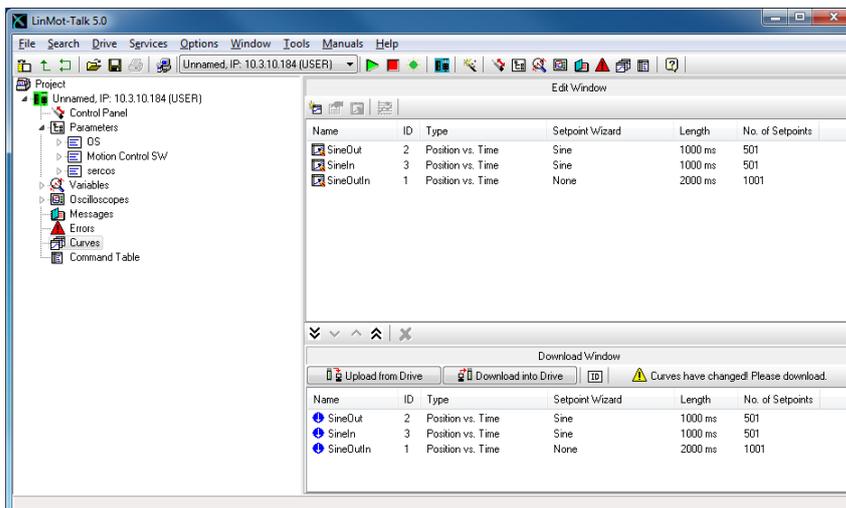


When double click the “SineOutIn” Curve the joined curve is shown:

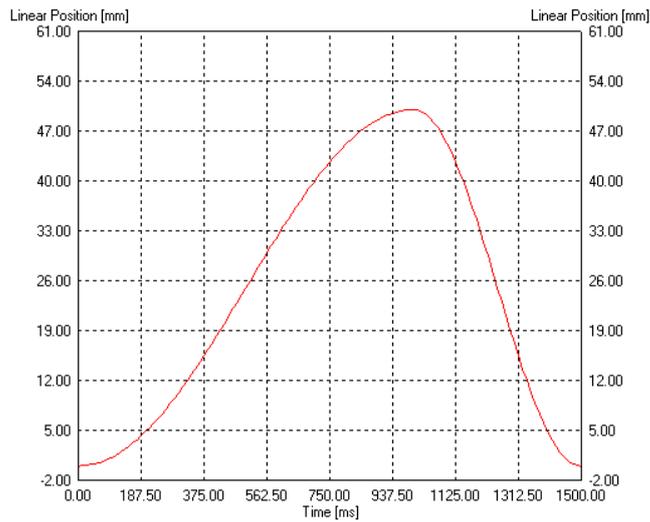


Now the curves must be downloaded to the drive. Therefore press the “Show Curves” button  and then the “Download Curves into Drive” button  **Download into Controller**. Then a warning comes up which has to be confirmed and the progress window will display the actions taken to download the curves.

### 3.17 Control Status

As we have defined now all parameters and curves, we will let the motor running. For this time, we will take over the interface control from the PC. So we are interface-independent. Switch to the control panel with the button , then press the start button  (starting the drive's firmware) and wait until the control status panel is updated and looks the following:

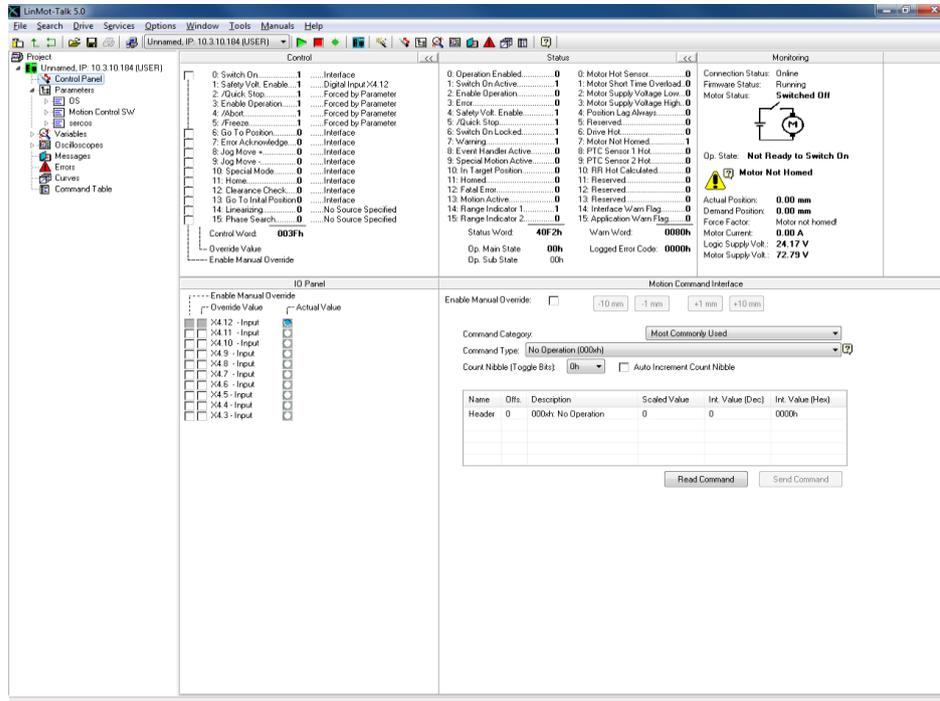

Now we will fetch the control over the “Switch On” and the “Home” flags.

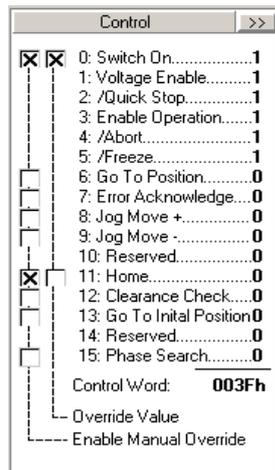


Now turn off and turn on again the “Switch On” flag, this is because of the auto start prevention. At this time, the motor will be powered and position controlled at the actual position. Set the “Home” flag and the motor will initialize against the inner hard stop.

When the motor stands still, clear the “Home” flag and the motor will run the curve continuously.


Detailed information about the MC software's state diagram can be found in the MC software manual.

### 3.18 Oscilloscope

The oscilloscope is a very useful tool for tuning the motor. The LinMot-Talk software has defined a default oscilloscope, which samples the actual position, demand position, position difference and demand current. When clicking on the “Show Oscilloscope” button , the focus will be set to the default oscilloscope. We could start the oscilloscope now with the start button , but it is recommended to set the recording time about 2 seconds (one curve cycle is 1.5 s). We will switch to the oscilloscope settings with 

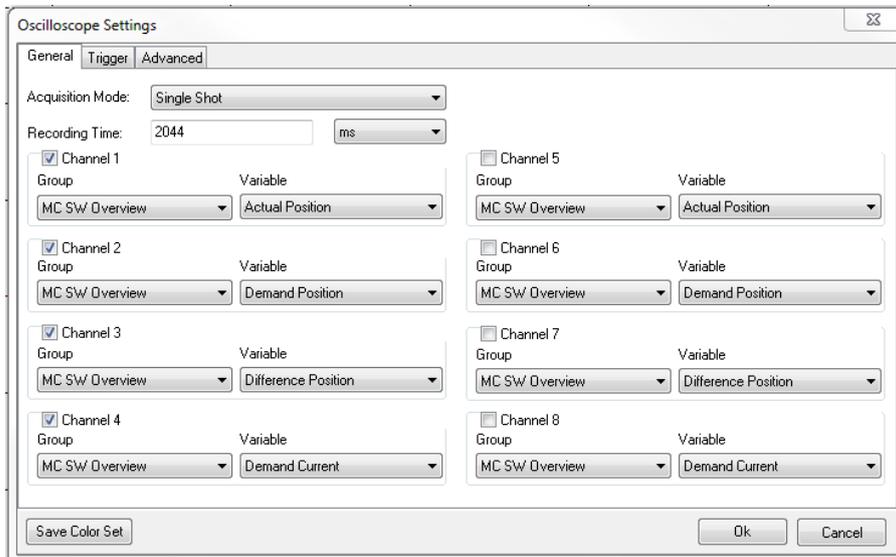

Then press Ok and start the oscilloscope with . The recorded data on will be read out from the drive and displayed, which will look somehow like the following.

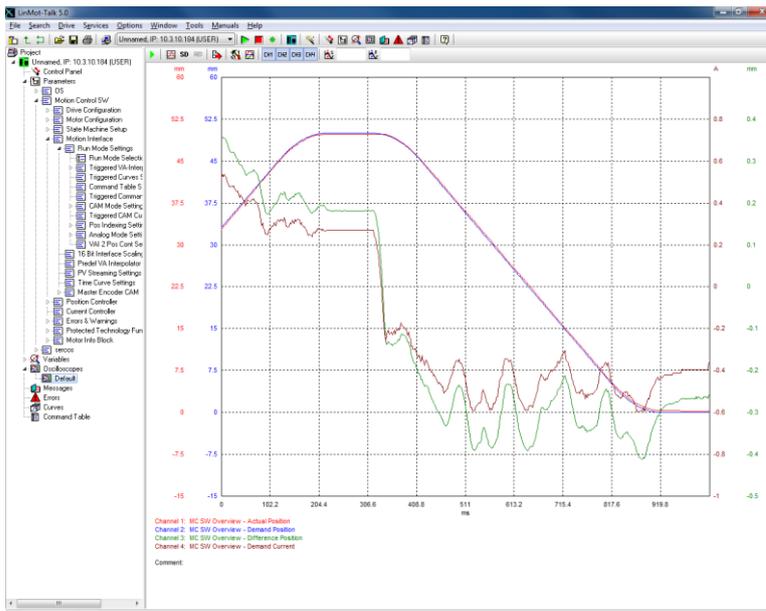


Possibly it is necessary to press button  (fit view).

Tuning the system would be started at this point. One possibility is by restarting the Motor Wizard and changing the load or control parameter, another one is to change the parameters directly in the parameter tree.


### 3.19 Continuous Two Point Mode

The easiest way to run the motor continuously is to set the VAI 2 Pos Continuous mode. In this mode the motor moves between the two positions Trig Fall and Trig Rise. The time the motor waits at the two positions is defined under “VAI 2 Pos Cont Settings”.

The minimal settings for this mode are shown next. First the mode has to be set:

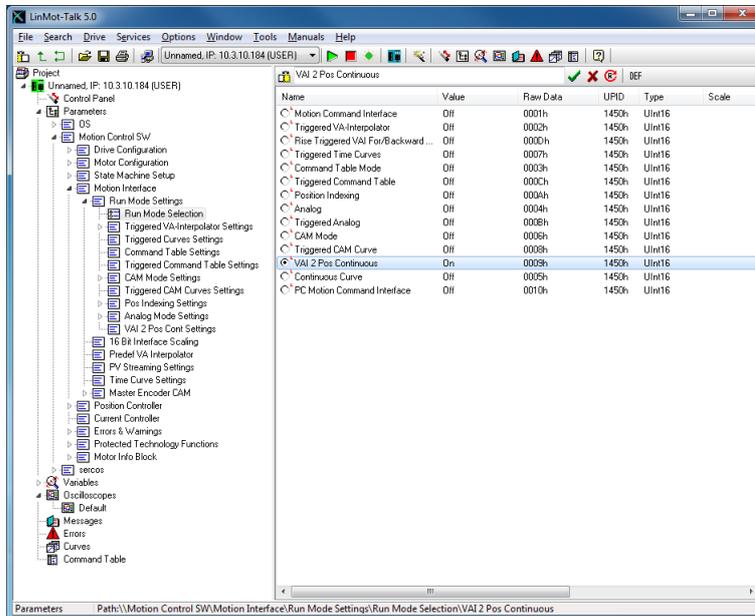


And then the positions have to be set under “Trig Fall Config\Position” and “Trig Rise Config\Position”:

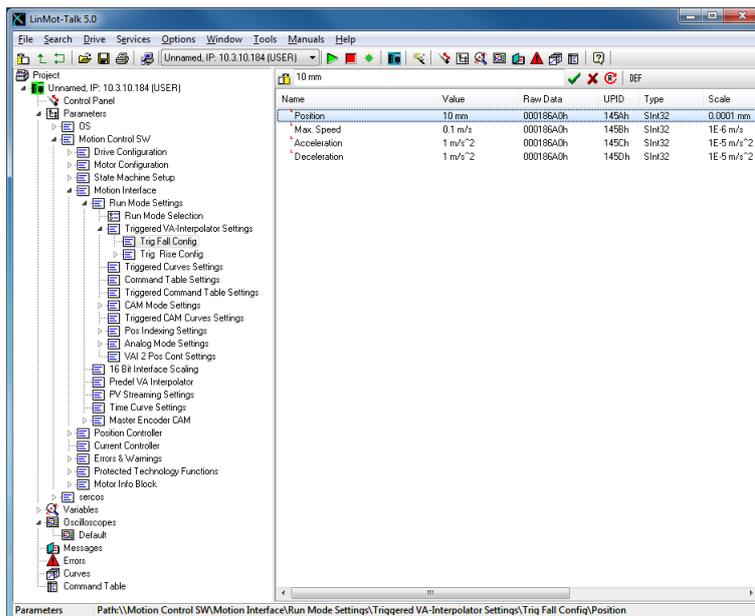

This is all we have to configure. The speed, acceleration and deceleration can also be defined at this place in the parameter tree. The motor can now be started the same way as described under [3.17](#).

### 3.20 Export Configuration

When the drive settings are done it is strongly recommended to save the complete configuration. This can be done under File → Export... or with by clicking on . After the file name dialog the selection of the drives and parts to be exported will be shown:

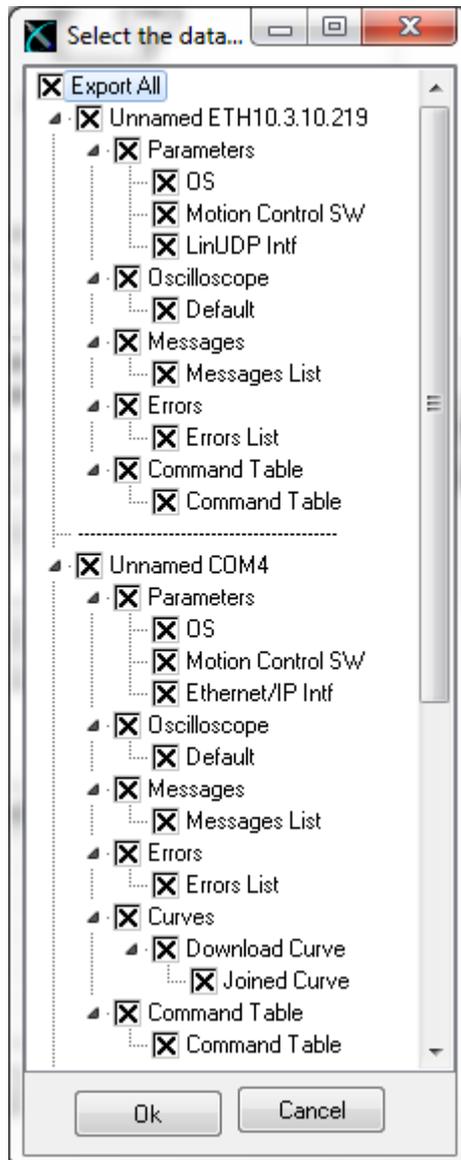


It is recommended to export all. For a configuration recovery it is necessary to select the parameters, curves and command table.

In case of a support request it is very helpful to provide the complete configuration as well (with variables, oscilloscope shots, message and error log).

### 3.21 Import Configuration

A configuration can be imported with File → Import... or with the button . First it open a dialog window.

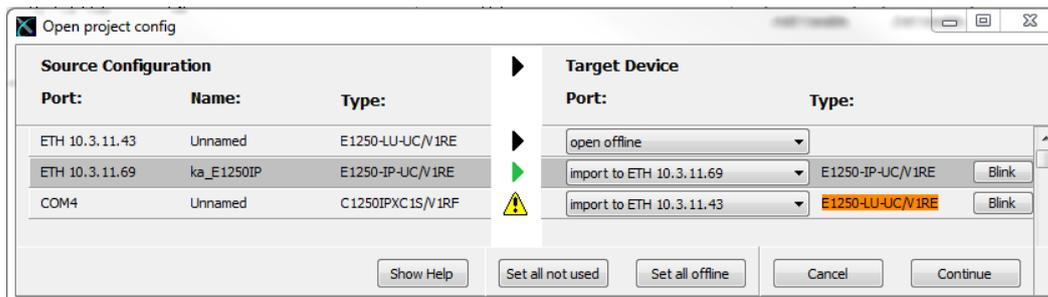

In this window each configuration in the file has a line, in the combobox a drive could be selected. In this drive the configuration will be loaded. There are four possibilities of imports. They have the followed Symbols.

✗ not used


▶ open offline

▶ import to a drive with the same drivetype like the drivetype in the config

⚠ import to a drive with a other drivetype then the drivetype in the config. In this case it can have some inconsistent parameter trees!

Two possibilities are always possible, not used and open offline. Not used means with this configuration nothing happens. Open offline means for this configuration an offline device will be created and the configuration will load in it. Each drive on it the LinTalk is logged in could only selected in one line at the time.

When opening a configuration to a drive, a compatibility list of the parameter trees will be shown. Then the selection of the importable parts will be shown:

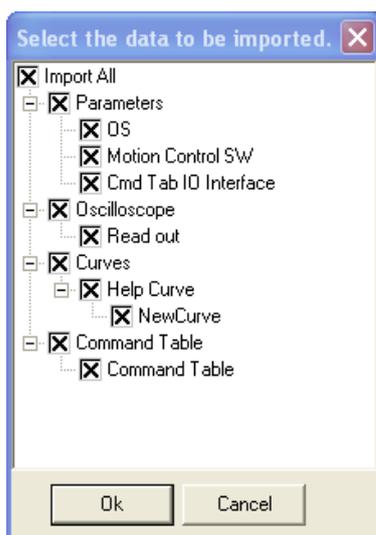

It is possible to import only some specific parts (e.g. curves or command table).

This part of import repeat until each configuration is load in the drives.

### 3.22 Open Offline Configuration


A configuration can also be opened when no drive is present. Under File → Login/Open offline...



This is a very helpful feature for supporting problems.

### 3.23 Create Offline Configuration


For any supported drive a configuration can be created offline. Choose the menu item File>Create Offline...

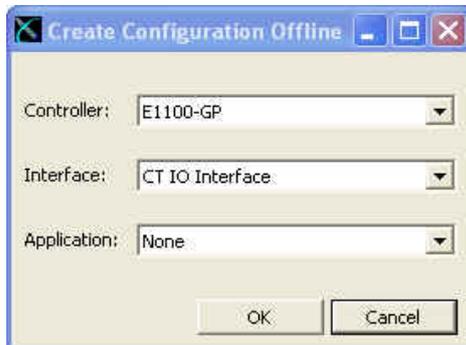

The above window will be shown. Select the drive first, then choose the interface and application software. The software parts, which can be selected, are the same as when installing firmware to the drive. When created the configuration, the parameters will have their default values. The configuration can then be altered and saved the normal way.

## 3.24 Compare Parameters

Under Drive → Compare Parameters, there is a function, which allows to compare the settings between different drives.

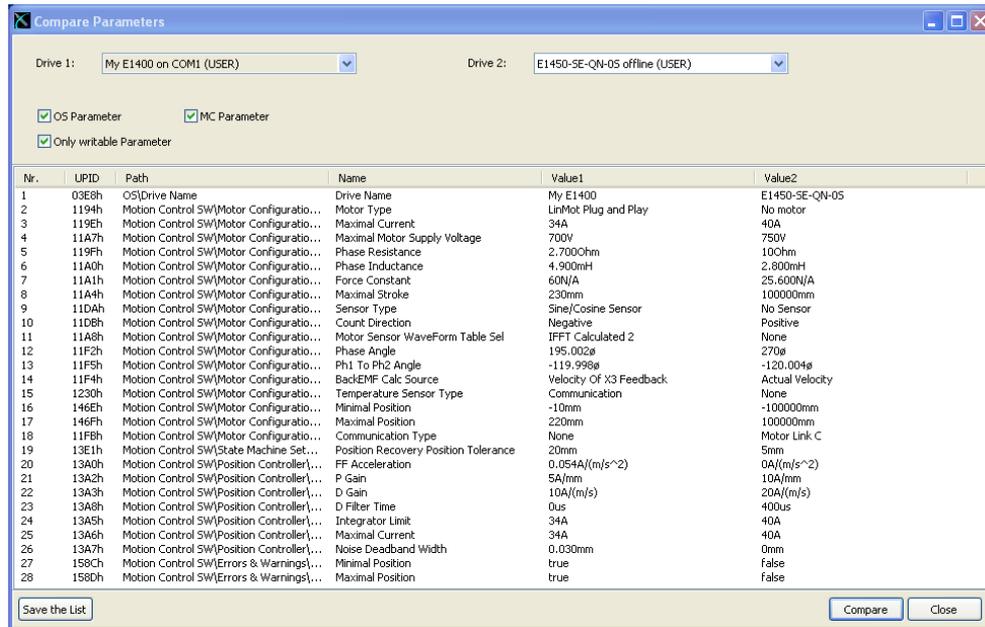

This useful function works with online and offline configurations. There are different setups available, such as firmware instances (OS, MC, INTF and APPL) or parameter types (read only or writable). The parameter list can be saved as a \*.pvl file (comma separated text file).

## 4 Trouble shooting

### 4.1 Setting all Parameters to Default Values

#### **E1100, E1200, E1400, B8050, MB8050, C1100-GP and C1250**

All parameters of the SG3 and SG5 drives can be set to their default values without the use of the LinMot-Talk. This can be done according these steps:

1. Power off the drive
2. Set the two ID switches to 0xFF
3. Power on the drive, the Error and Warn LEDs will blink alternately at ~4Hz.
4. Set the two ID switches to 0x00
5. Wait until the Warn and EN LEDs will flash together at ~2Hz.
6. Power off and on again.

#### **B1100**

On SG4 drives an image of the default parameters will be stored during the software installation. This image can be reloaded to the operating parameters. The procedure is the following:

1. Set the parameter with UPID 0x6085 to 0x0001.
2. Power off the drive.
3. Power on the drive.

The value of the parameter with UPID 0x6085 will be automatically cleared to 0x0000.

#### **A1100**

All parameters set to their default values without the use of the LinMot-Talk. This can be done according these steps:

1. Power off the drive
2. Set the DIP switch S5.2 to on
3. Power on the drive, the Error and Warn LEDs will blink alternately at ~4Hz.
4. Set the DIP switch S5.2 to off
5. Wait until the Warn and EN LEDs will flash together at ~2Hz.
6. Power off and on again

## 4.2 Interface does not run

If the interface software (DeviceNet, CANopen, Profibus, LinRS) does not communicate there may be several reasons:

- Specific Interface Software not installed
- Switch S3.4 “Interface” on drive’s bottom side must be set to “On”. (In case of LinRS, this switch must be set to off when configuring over RS232, and set to on when running the LinRS interface).
- Parameter with UPID 2008h set to disable.
- Baud Rate and Node ID selection not correctly set (Parameters and/or ID switches on drive’s front).

## 4.3 Stopping Firmware

When the same link is used for configuration purposes and from the interface (e.g. RS232 link and LinRS interface) it may not be possible to login with the LinMot-Talk software. In some cases, it should be possible to log in, e.g. to download new firmware.

On E1100 drives, the interface switch S3.4 can be set to off and after a power up the interface software should be deactivated and the configuration link should be free. If this does not help, or you are working with a B1100 drive, there is a script under File -> Open -> StopFirmware.sct, which keeps trying to stop the drives firmware while it is powered on. After a power up, within the first 2 seconds the interface can be prevented from starting.

## 5 Contact Addresses

---

**SWITZERLAND****NTI AG**

Bodenaeckerstrasse 2  
CH-8957 Spreitenbach

**Sales and Administration:** +41-(0)56-419 91 91  
office@linmot.com

**Tech. Support:** +41-(0)56-544 71 00  
support@linmot.com

**Tech. Support (Skype):** skype:support.linmot

**Fax:** +41-(0)56-419 91 92

**Web:** <http://www.linmot.com/>

---

**USA****LinMot, Inc.**

204 E Morrissey Dr.  
Elkhorn, WI 53121

**Sales and Administration:** 877-546-3270  
262-743-2555

**Tech. Support:** 877-804-0718  
262-743-1284

**Fax:** 800-463-8708  
262-723-6688

**E-Mail:** [us-sales@linmot.com](mailto:us-sales@linmot.com)

**Web:** <http://www.linmot-usa.com/>

---

Please visit <http://www.linmot.com/> to find the distributor closest to you.

Smart solutions are...

